
OREGON CORNER RESTORATION FORM

Section County	4 Umatilla	Township _ Date:	1SRange December 11, 2015	32E_	
Corner Des	signation:	1S32C9			Condition Report Only Not found
Quarter corner to sections 4 and 5, T1S, R32E, W.M. Umatilla County, Oregon.				X	_Remonumented Unrecorded _Surveyed in _Referenced out

Previous Renewals / Surveys, etc.

The corner was originally set by Daniel Chaplin under contract No. 107 dated September 21, 1864. His record reads: Set post for 1/4 Sec. Cor., in mound of earth, with charred stake, pits, etc., as per instructions. In 1973 under survey I-44-B, Donald Staebler set a 2" iron pipe by proportion using the record notes dimension which was different from the plat. There being no evidence to discern between the plat or notes at this corner, I have held Staebler's position.

Monument and Accessories found: (condition and source) None. This position falls in the east track of a gravel field road.

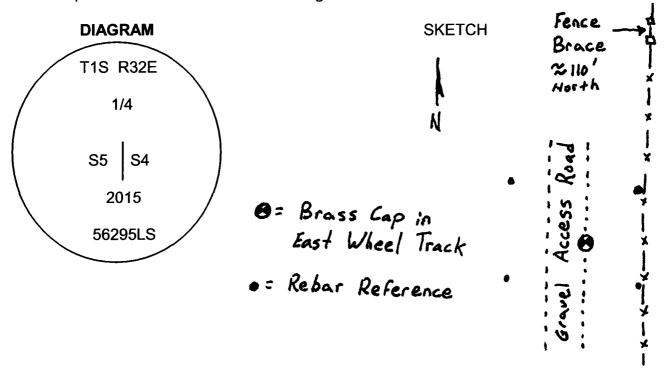

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)

At the position determined from Staebler's survey, I set a 2 1/4"brass cap on a 1 1/2" x 30" galvanized iron pipe stamped as shown in the diagram above 6 inches below the surface of the road.

For references I set four 5/8" x 24" iron rebars with 1 1/8" orange plastic caps stamped WTS and 56295LS as described below:

an iron rebar bears N50°15'17"E, 31.14 feet under the existing fence; an iron rebar bears N55°07'26"W, 25.07 feet eight inches below the surface; an iron rebar bears S49°33'26"E, 30.77 feet under the existing fence; an iron rebar bears S47°37'27"W, 26.69 feet 12 inches below the surface;

These references were set and tied using a Trimble R7/R8 RTK GPS

Location and comments **Compass Declination** Surveyors Seal Firm / Agency REGISTERED Witness Tree Surveying **PROFESSIONAL RECEIVED BY:** Address LAND SURVEYOR Umatilla County Surveyor P.O. Box G Pilot Rock, Or. 97868 4105/01/1 **Party Chief** Rec'd By: (OREGON Stephen K, Haddock JULY 9, 2001 HEN K. HADDOCK 56295LS

RENEWS: 6-30-17