

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla. DATE: 04/17/17.

CORNER DESIGNATION: G-5, The East one-quarter corner of Section 7, Township 2 North, Range 28 East, W.M..

PREVIOUS RENEWALS/SURVEYS ETC: Corner originally established by David P. Thompson Contract No. 83 dated July 22, 1859. Notes state: Set post corner for 1/4 Sec. corner in mound of earth & as per instructions. The corner point was reestablished by John Kimbrell, Deputy County Surveyor, in Survey No. 357, recorded at Record of Private Survey Book 2, Page 216, in December, 1912. Kimbrell reports setting a marked square wood post 18" in the ground at the corner point.

MONUMENT AND ACCESSORIES FOUND: None. Reestablished corner position by single proportionate measure.

MONUMENT MARKING DETAIL:

T2N R28E
1/4
S7 | S8
2017
PLS 1106

MONUMENT SET: At the reestablished corn position, set a 1 1/4 by 30" galv. iron pipe with 2 3/8" brass cap 28" in the ground. Cap is marked as shown in "Monument Marking Detail".

New accessories:

A 5.8" rebar with 1 1/4" red plastic cap bears N 00° 10' 20" W, 663.78 feet. This is the NE corner of the SE1/4 of the SE1/4 of the NE1/4 of Section 7.

Top center of a monitoring well bears S 26° 20' E, 183.4 feet.

A 5/8" rebar with 1 1/4" red plastic cap bears N 89° 56' 34" W, 664.13 feet. This is the SW corner of the SE1/4 of the SE1/4 of the NE1/4 of Section 7.

A 5/8" rebar with 1 1/4" red plastic cap bears N 45° 03' 56" W, 940.99 feet. This is the NW corner of the SE1/4 of the SE1/4 of the NE1/4 of Section 7.

The red plastic caps are marked "ORPLS 1106 WAPLS 17372". Set steel fence post 1 1/2 feet South of corner with "witness" sign wired to it.


LOCATION AND COMMENTS: Corner falls in cultivated field just West of a farm road running North-South.

FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801


COMPASS DECLINATION: 18° East

Surveyor's Seal

\2N28G5

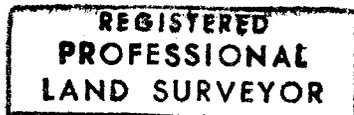

William R. Wells

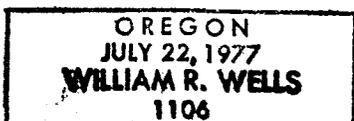

renews 6-30-18