OREGON CORNER RESTORATION FORM

Section County	32 Umatilla	_Township _Date:	3N Range September 14, 2016	<u>30E</u>	
Corner Des	signation:	3N30X9			Condition Report Only Not found
Quarter corner common to sections 32 and 33, T3N, R30E, W.M., Umatilla County, Oregon.				x	_Remonumented Unrecorded
		·	_	X	_Surveyed in


Previous Renewals / Surveys, etc.

Location and comments

Corner originally set by William B. Campbell under contract No. 95 Dated September 19, 1860. His record reads: Set post for 1/4 section corner drove a charred stake and raised mound of earth with trench and pits as per instructions. John Arnold in the record of private surveys, Book 1 Page 200 set a flat basalt stone 15x11x2 ins. marked "1/4" on west face.

Monument and Accessories found: (condition and source)

This point falls in a county road running north and south with a plow berm running west.

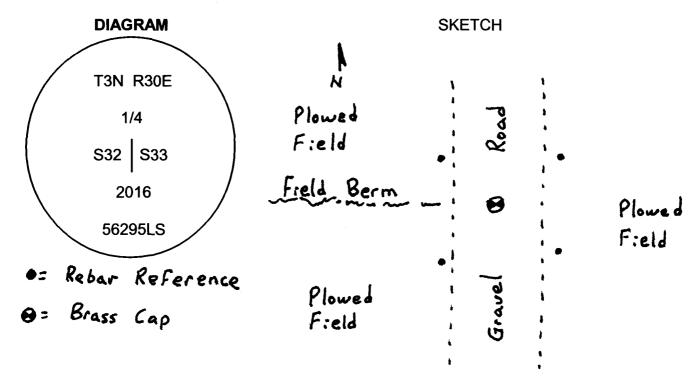

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)
I set a 1 1/2" x 30" galvanized iron pipe with a 2 1/2" brass cap stamped as shown in the diagram above at the intersection of the road centerline and the plow berm. The cap is 6" below the surface of the road.

For references, I set four 5/8" by 24" iron rebars with 1 1/4" orange plastic caps stamped WTS 56295LS as described below:

an iron rebar bears N50°07'26"W, 17.46 feet, 12 inches below the surface; an iron rebar bears N52°01'21"E, 16.34 feet, 12 inches below the surface; an iron rebar bears S42°09'23"E, 17.61 feet, 12 inches below the surface; an iron rebar bears S48°13'17"W, 19.29 feet 12 inches below the surface;

The monument and references were tied using a Trimble R7/R8 RTK GPS system.

REGISTERED Firm / Agency **PROFESSIONAL** Witness Tree Surveying LAND SURVEYOR **Address RECEIVED BY:** P.O. Box G **Umatilla County Surveyor** K. Hallock Pilot Rock, OR 97868 Date: 4/2/2017 Rec'd By: X Party Chief **OREGON** JULY 9, 2001 No. 17-005-Stephen K, Haddock

Compass Declination

RENEWS: 6-30-17

PHEN K. HADDOCK 56295LS

Surveyors Seal