OREGON CORNER RESTORATION FORM

Section 25 Township 5N Range 30E
County Umatilla Date: 05-08-2006

Corner Designation: 5N30E T24

_____	Condition Report Only
_____	Not Found
_____	Remonumented
____X____	Unrecorded
____X____	Surveyed In
____X____	Referenced Out

Previous Renewals / Surveys, etc.
10-1940 ODOT (5B-29-11) East/West line only (no location).

Monument and Accessories Found: (condition and source)
Monument had not been set.

DIAGRAM

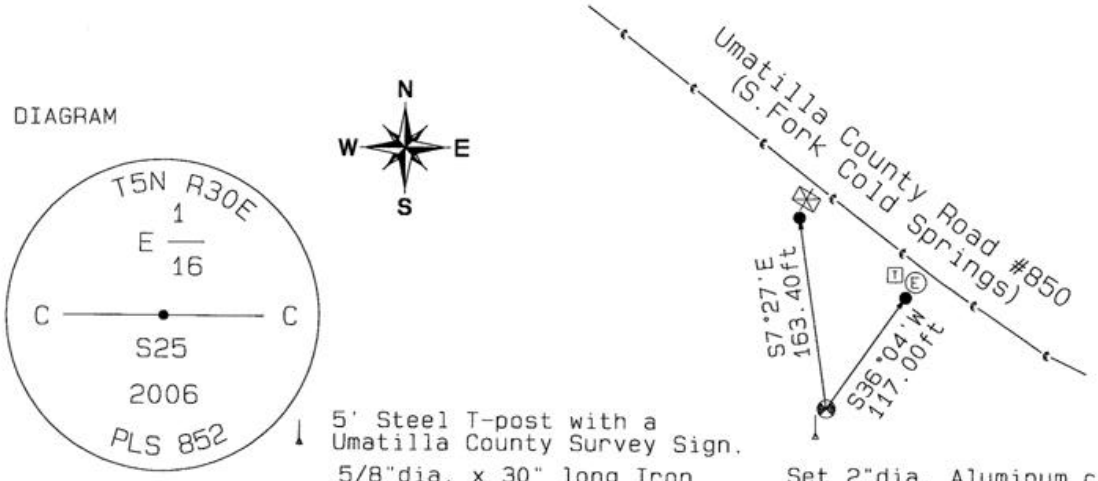

5' Steel T-post with a Umatilla County Survey Sign.

5/8"dia. x 30" long Iron Rebar with a 1.3"dia. Red plastic cap.

Set 2"dia. Aluminum cap on a 5/8" x 30" long Iron Rebar.

Wood R.R. Tie

Telephone pad

10" Wood Power pole

MONUMENT(S) AND ACCESSORIES SET (Procedures and Description)

Set a 2"dia.Aluminum Cap (stamped as shown) on a 5/8"dia. x 30"long Iron Rebar 4" above the ground surface on a North face of a hillside. Set a 5' steel T-Post with a Umatilla County Survey Marker sign facing South 12 inches South of the corner.

REFERENCES SET:

Set two (5/8" dia x 30" long Iron rebar with a 1.3" dia. Red plastic cap) to the bearings and distances from monument shown above in the sketch.

Made GPS tie to TRI Stations
LAURILA RESET RB 1379 and
WALLS RB 1396
Latitude 45 °53'08.05129"N
Longitude 119°00'01.48738"W
NAD 83(1991)

Oregon State Plane Coord. - North Zone

Northing	812520.31
Easting	8583964.36
Ortho Height	884.01
Ellipsoidal Height	814.86

Location and Comments

Compass Declination
18°E

Surveyors Seal

Proceed Southwest from the junction of HWY 37 and South Cold Springs Highway approximately 880 feet on South fork Cold Springs highway to the reference monuments on the Southwest of the highway.
Thence 115 feet Southwest up the hillside to the monument.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

RECEIVED BY:

Date 02-07
Rec'd By: OHC
No.: 07-11-8

Firm / Agency

Haddock Surveying
P. O. Box 1574
Pendleton, OR 97801
(541) 276-2174

David L. Haddock

OREGON
JULY 12, 1968
DAVID L. HADDOCK
852

RENEWS 6-30-07