OREGON CORNER RESTORATION FORM

Section 30 Township 5N Range 30E
County Umatilla Date: 05-08-2006

Corner Designation: 5N30E T25

____	Condition Report Only
___X___	Not Found
____	Remonumented
____	Unrecorded
___X___	Surveyed In
___X___	Referenced Out

Previous Renewals / Surveys, etc.

08-1859 D.Thompson GLO (81) "Set post for 1/4 Sec corner and build mound of Earth with pits & trench & charcoal as per instructions"

Monument and Accessories Found: (condition and source)

Searched for post. Not found. Plowed edge of field in CRP.

DIAGRAM

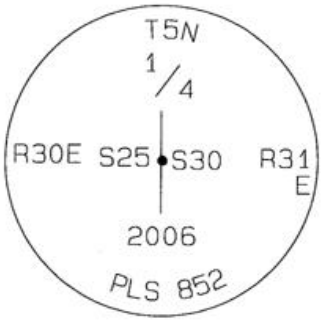

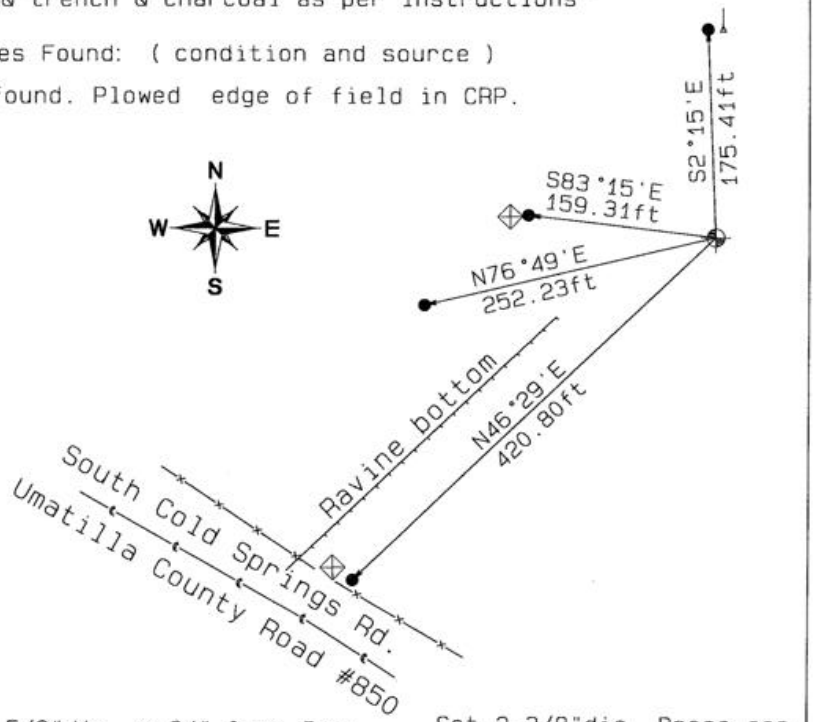

Wood fence post

Wire Fence line

5/8"dia. x 24" long Iron Rebar with a 1.3"dia. Red plastic cap.

Ravine bottom

Set 2-3/8"dia. Brass cap on a 1-1/2" x 30" long Galvanized pipe monument.

5' Steel T-post.

MONUMENT(S) AND ACCESSORIES SET (Procedures and Description)

Set a 2-3/8"dia.Brass Capped monument (stamped as shown) on a 1-1/4"ID x 30"long galvanized pipe 24" below the ground surface. Set a Umatilla County Survey Marker sign on a lone wooden fence post Northwest with a RM. UCSM and Bearing Object sign are facing Southeast.

REFERENCES SET:

Set four (5/8" dia x 30" long Iron rebar with a 1.3" dia. Red plastic cap) to the bearings and distances from monument shown above in the sketch.

Made GPS tie to TRI Stations
LAURILA RESET RB 1379 and
WALLS RB 1396
Latitude 45 °53'08.02787"N
Longitude 118°59'43.18266"W
NAD 83(1991)

Oregon State Plane Coord. - North Zone
Northing 812528.14
Easting 8585261.17
Ortho Height 964.37
Ellipsoidal Height 895.23

Location and Comments

Compass Declination
18°E

Surveyors Seal

Proceed Southeast from the junction of HWY 37 and South Cold Springs Highway approximately 0.35 miles. Located on the North side of the County Road.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

RECEIVED BY:

Date 02-07
Rec'd By: 02-11-8 DHK
No.:

Firm / Agency

Haddock Surveying
P. O. Box 1574
Pendleton, OR 97801
(541) 276-2174

David L. Haddock

OREGON
JULY 12, 1968
DAVID L. HADDOCK
852

RENEWS 6-30-07