CORNER CORNER SEC. 34 ON SEC. 4 T2S,R35E,WM 33 34 Condition Report Only Not Found Condition Re

Previous Renewals/Surveys, etc.

Set by Jacob Cooper Contract #397 JULY 1,1881

Renewed by Manius Buchanan Contract #635 APRIL 19,1895

Both Buchanan BT's found by C.T.Palmer CS# M-46, 1975

Monument(s) & Accessories Found: (Condition and Source)

CORNER - 14" long 3" Dia. 18" Deep Pointed wood POST/STAKE

CS# M-46 HUB & TACK N1°52'E 1.27 feet from found GLO POST


BT record distances fit to face of trees from post.

GLO BT 14" Tamarack Scribed "R35E S BT" Visible partially-healed with FOREST SERVICE LOCATION POSTER and GEORGIA PACIFIC

Location Poster; used increment borer in non-scarred tree truck area to confirm tree overgrowth age by ring count.

GLO BT Stump and Backcast of Scribing[very little remaining of tree] (Tamarack 14" Diam. bears N70° W 110 lks. marked "T1SR35ES33CCBT")

Monument Detail

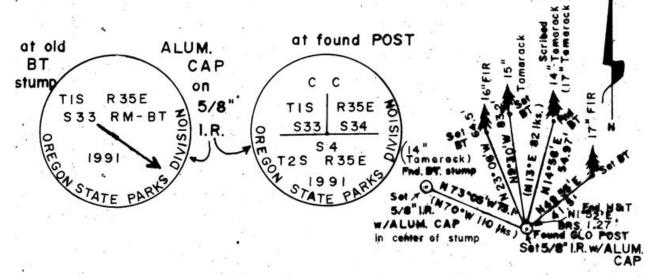

Monument Set (Procedures and Descriptions) Drove 5/8" Iron Rod w/Alum. Cap through center of existing GLO POST remains. Drove 5/8" Iron Rod w/Alum.Cap through center of existing GLO BT stump remains (Tamarack 14" Diam. bears N76°W110 lks. dist. marked "T1SF35ES33CCBT"). This rod bears N73°05'W 73.09 fee&ECKIVED BY from CORNER. Umatilla County Surveyor New Accessories Orange Carsonite set 2 feet South of CORNER. Scribed "T1SR35ES33CCBT" 16" White FIR N23°W 64.5' Scribed "T1SR35ES33CCBT" 15" Tamarack N10°W 83.2' 17" White FIR N50°E 41.5' Scribed "T1SR35ES34CCBT" OREGON STATE PARKS metal Location Poster mailed to each BT. Location & Comments Compass Declination N/A Surveyor's used PENTAX EDM By: 10 sec. Theodolite Oregon State Parks & Recreation Department Calc. Bearings from unadjusted traverse. 525 Trade Street, S.E. AND SURVEYOR N1/4 Sec.4 T2S,R35E Salem, OR 97310 found same date bears Party Chief: Billy J.W. Hermann approximately N89°10W 767.3 feet Notes: Billy J.W. Hermann OREGON

Witness: Andrew T. Blackly
Harold Hanson

by unadjusted

traverse.