OREGON CORNER RESTORATION FORM

Section: County:

29, 30 Umatilla Township: 3N

Range:

33E

Date: 3/17/2011

Corner Designation:

3N33T05 (Amended 3/13/2012)

Quarter corner common to Sections 29, 30, T3NR33E.

Condition Report Only **Not Found** X Remonumented Unrecorded X Surveyed In Referenced Out

Sketch

IR

BC

IR

IR'

JR


Previous Renewals / Surveys, etc.

Originally surveyed by Chaplin in 1864. He set a post in a mound of earth.

Monuments and Accessories Found: (Condition and Source):

None.

Diagram

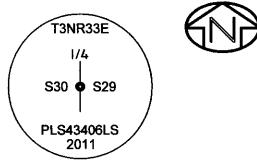

NAD 83/91 OREGON STATE PLANE NORTH INTERNATIONAL FEET

N750137.71 E8655511.96

Monument(s) Set (Procedures and Description):

A 1 1/8" x 30" galvanized iron pipe with a 2 1/2" brass cap, stamped as shown above. Held ancient fence comer as best evidence of occupation and location of comer.

References Set:

A 5/8" x 30" iron rebar w/RPC #43406 lies N 89° 20' E, 32.29'. A 5/8" x 30" iron rebar w/RPC #43406 lies S 88° 30' E, 11.42'. A 5/8" x 30" iron rebar w/RPC #43406 lies S 1° 10' E, 22.94'. A 5/8" x 30" iron rebar w/RPC #43406 lies S 0° 40' E, 10.24'.

Location and Comments:

The corner is located 0.7 miles, M/L, West Northwest of the intersection of Adams Rd. and Myrick Rd. at the intersection of two fence lines.

Compass Declination

17° E

Surveyors Seal

REGISTERED **PROFESSIONAL** LAND SURVEYOR

750x (2)

RECEIVED BY:

Survey One, LLC. P.O. Box 382 Pendleton, OR 97801 (541) 276-2055

43406LS **RENEWAL DATE: 12/31/13**

OREGÓN

JANUARY II, 2005 ROBERT DOUGLAS ENGLISH

Firm / Agency

Date: Rec'd By: ,