## OREGON CORNER RESTORATION FORM

Section: County:

35, 36 Umatilla Township: 3N

Date: 12/20/2011

Range:

33E

Corner Designation:

3N33X21

Quarter corner common to Sections 35, 36, T3NR33E.

Condition Report Only Not Found Χ Remonumented Unrecorded X Surveyed In Referenced Out


Previous Renewals / Surveys, etc.

Originally surveyed by in Chaplin1864. He set a post in a mound of earth with charred stake and pits. In 1871 Moody set a post in a mound of earth.

in 1887 Currin and Noland set a post in a mound of earth with pits North and South.

# Monuments and Accessories Found: (Condition and Source):

None.

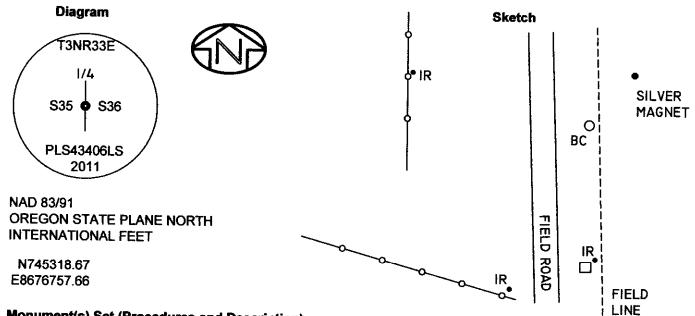

Monument(s) Set (Procedures and Description):

A 1 1/8" x 30" galvanized iron pipe with 2 1/2" brass cap, stamped as shown above, flush with the surface. The corner location was reestablished by single proportionate method between an accepted intersection North and a found monument South.

#### References Set:

"Deep One" magnet by Berntsen.

A 5/8" x 30" iron rebar lies N 73° W, 76.52', at a steel fence post. A silver magnet lies N 42° 50' E, 27.52', 1.8' deep.

A 5/8" x 30" iron rebar lies S 2° E, 56.04', at a wooden post.

A 5/8" x 30" iron rebar lies S 26° 30' W, 163.18', at a steel fence post.

### **Location and Comments:**

The comer is located 1/2 mile North and 1 mile West of the intersection of Kirkpatrick Rd. and North Cayuse Rd.

#### **Compass Declination**

17° E

#### Surveyors Seal

REGISTERED **PROFESSIONAL** LAND SURVEYOR

## **RECEIVED BY:**

Date: Rec'd By

## Firm / Agency

Survey One, LLC. P.O. Box 382 Pendleton, OR 97801 (541) 276-2055

OREGON JANUARY II, 2005 ROBERT DOUGLAS ENGLISH 43406LS

RENEWAL DATE: 12/31/13