

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 1/15/16

CORNER DESIGNATION: R-19, The North Quarter Corner of Section 26, Township 3 North, Range 34 East, W.M.

PREVIOUS RENEWALS/SURVEYS ETC.: Most recent field notes for the corner by Currin and Noland under special contract dated May 4th, 1887 state: Deposit charred stake 12 ins. in the ground for ¼ sec. corner.

MONUMENT AND ACCESSORIES FOUND: None. Held the intersection of the visual centerline of Tubbs Ranch Road (East-West) and a field berm extending South as the best remaining evidence of the corner.

MONUMENT MARKING DETAIL:

T3N R34E
1/4 S23
S26
2016
PLS 54657

MONUMENT SET: At the corner point set a 5/8"x30" iron rebar with a 2" aluminum cap 1" below paved road surface. Monument marked as shown in "Monument Marking Detail".

From which:

A 5/8"x24" iron rebar with 1 ¼" blue plastic cap marked "Wells Surveying 54657PLS" 2" above ground level in road bank bears North 55° East, 35.8 feet.

A 5/8"x24" iron rebar with 1 ¼" blue plastic cap marked "Wells Surveying 54657PLS" 2" above ground level in road bank bears South 59° East, 41.4 feet.

A 5/8"x24" iron rebar with 1 ¼" blue plastic cap marked "Wells Surveying 54657PLS" 2" above ground level in road bank bears South 51° West, 37.3 feet.

A ¾" diameter brass washer stamped "PLS 1106" 1.5 feet above ground level in a power pole bears North 32° West, 26.4 feet.

Attached bearing object signs to all rebar. Nailed bearing object sign to power pole near brass washer.


LOCATION AND COMMENTS: Corner is located at the intersection of the visual centerline of Tubbs Ranch Road (East-West) and a field berm extending South. See map filed concurrently with this certificate for further information.

FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

/3N34R19

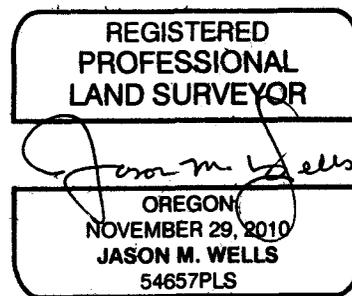

RENEWS: 6:30:16

16-008-C