
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by Frank W. Campbell in 1883 under General Land Office contract number 468. Corner was subsequently reestablished by Otis S. Gould in July 1939 for the U.S. General Land Office. Surveyor Gould record states:

At proportionate measurement set an iron post 3 feet long, 1 inch in diameter, 27 inches in the ground for $\frac{1}{4}$ section corner, with brass cap marked (as shown below) from which:

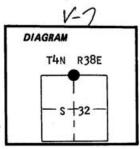

A Pine 9 inches diameter bears N15°E, 13 1ks dist marked $\frac{1}{4}$ S29 BT A Pine 12 inches diameter bears South 22 1ks dist marked $\frac{1}{4}$ S32 BT

No record of subsequent remonumentation found in county records Description of corner evidence found:

Found 1 inch galvanized iron pipe with 2 inch brass cap marked as shown below, firmly set 3 inches above ground

Found steel fencepost approximately 5 feet East with 54-2 and 54-4 signs attached

Found a 12 inch diameter Lodgepole Pine N20 $^{\rm O}$ E (record N15 $^{\rm O}$ E) 8.0 feet (record 13 1ks) Blaze evident and partial scribes visible

Description of monument and accessories I established to perpetuate the original location of this corner:


New BTs

A 15 inch diameter Spruce bears $$15^{\circ}E$, 26.8 feet marked $\frac{1}{4}$ \$32 on a single blaze New tree taken July 12, 1985

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Myory To Blockman

OREGON
JULY 13, 1973
GREGORY I. BLACKMAN

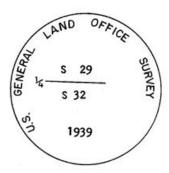

I used a steel tape and magnetic compass in the establishment of this accessory. I used 20° East magnetic declination and the distance is to the center of the tree. I set a brass washer marked OPLS 991 by the BT blaze. I painted a 6 inch red band around all BTs and attached 54-3 and 54-4 signs

Office of	. County of
State of, / hereby certify to	hat the within instrument was filed in this office
for record on the day of	
by	
(COUNTY OFFICIAL)	(DEPUTY)
RECE	EIVED BY

Form R6-7100-57 (9/71)

Umatilla County Surveyor

Date 7-24-85

☆ GPO-798-276