
OREGON CC NER RESTORATION FORM Section 31 Township 5N Range 31E County 10-29-2006 Umatilla Date: Condition Report Only Corner Designation: 5N31E X4 Not Found Remonumented Unrecorded Surveyed In Previous Renewals / Surveys, etc. Referenced Out None recorded. Center-East 1/16th corner Section 31. Monument and Accessories Found: (condition and source)

No monument found. Found 5" x dia x 5' long steel – hollow axle Northwest of the corner on top of the ground surface – East of a wood fence post.

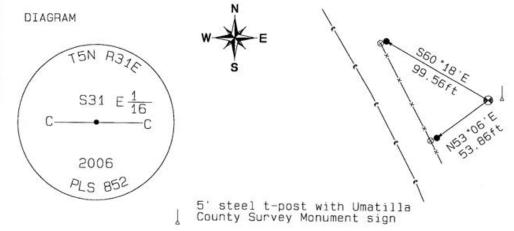

5/8"dia. x 30" long Iron Rebar with a 1.3"dia. Set 2"dia. Aluminum cap on a 5/8" x 30" long Iron Rebar. ⊗ Wood fence post Red plastic cap.

MONUMENT(S) AND ACCESSORIES SET (Procedures and Description)

Set a 2"dia. Aluminum Capped monument (stamped as shown) on a 5/8"OD x 30"long Iron rebar 2" above the ground surface Set a 5' steel T-post with a Umatilla County Survey Marker sign Set a 5' steel T-post with 12" North of the monument .

REFERENCES SET:

Set two (5/8" dia x 30" long Iron rebar with a 1.3" dia. Red plastic cap) to the bearings and distances from monument shown above in the sketch.

Made GPS tie to TRI Stations LAURILA RESET RB 1379 and WALLS RB 1396 45 *52 15.51560 N Latitude 118 °58 ' 47.00138 "W Longitude NAD 83 (1991)

Oregon State Plane Coord. - North Zone Northing 807284.50 Easting Ortho Height 8589334.84 1025.58 Ellipsoidal Height 956.60

Location and Comments

Compass Declination 18 °E

Surveyors Seal

REGISTERED PROFESSIONAL

Proceed from the junction of HWY 37 and South Cold

Springs Highway Southeast on S. Cold Springs Hwy (Umatilla County Rd # 850) approximately 1.56 miles. Thence 100 feet Northeast up the hill to the corner.

LAND SURVEYOR David L. Haddock

RECEIVED BY:

Date 02-07

Rec'd By: _ No .: 07-213-R Firm / Agency

Haddock Surveying P. O. Box 1574 Pendleton, OR 97801 (541) 276-2174

OREGON 12, 1966 I. HADDOCK DAVID L. H

RENEWS 6-30-07