## OREGON CORNER RESTORATION FORM


Section Township 5N Range 36E County <u>Umatilla</u> September 24, 2012 Date: Condition Report Only **Corner Designation:** 5N36J5 Not found Remonumented Corner common to sections 7, 8, 17, and 18, Unrecorded T5N, R36E, W.M., Umatilla County, Oregon. Surveyed in Referenced out

Previous Renewals / Surveys, etc.

Corner was originally set by Odell and Lewis under contract No. 110 dated February 7, 1865. Their record reads: Set post corner for secs. 7, 8, 17 and 18. Drove charred stake, dug pits, raised mound, as per instructions.

Monument and Accessories found: (condition and source)

A basalt stone 11x7x6 ins. on the east side of a locust field marker post at the intersection of field lines to the north, east, and west.

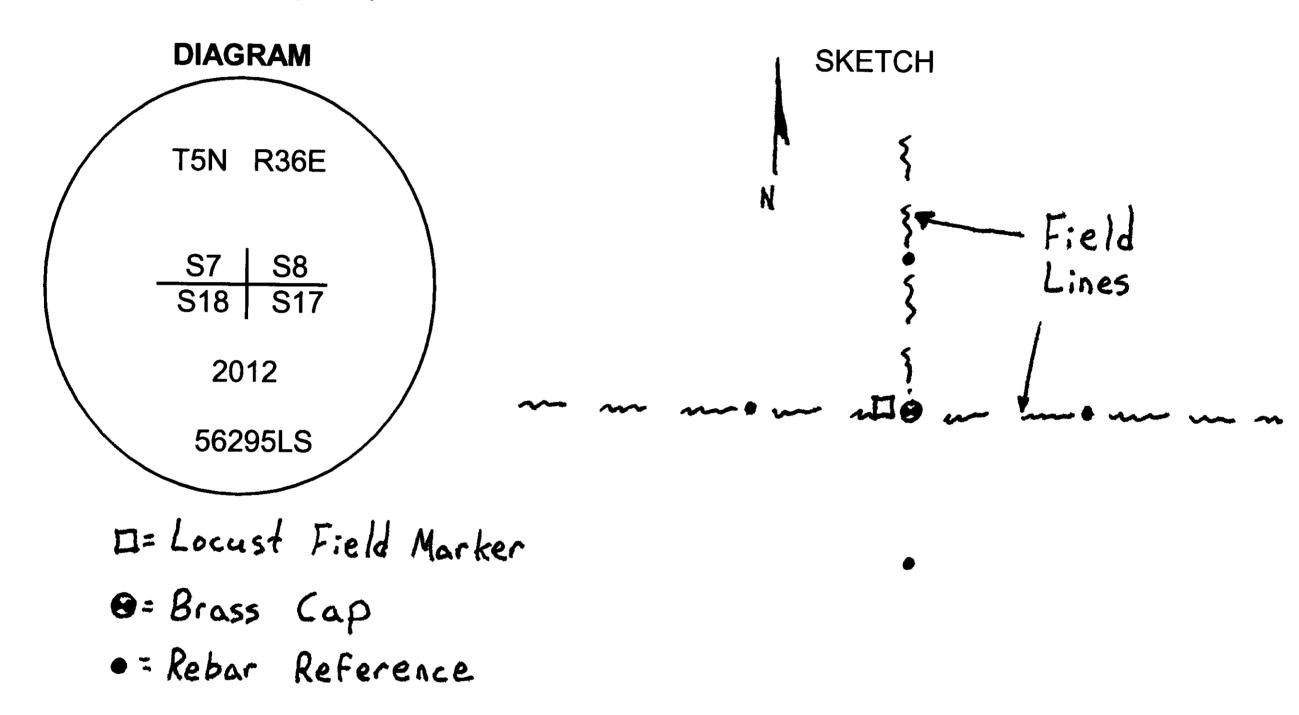

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description) I set a 2 3/8" brass cap on a 1 1/2"x30" galvanized iron pipe with a brass cap stamped as shown in the diagram above at the position of the found stone.

For references: I set 4, 5/8"x24" iron rebars with orange plastic caps stamped WTS and 56295LS as described below 20 inches below the surface of the ground:

An iron rebar bears S87°56'29"W, 31.96 feet;

An iron rebar bears N2°31'44"E, 31.09 feet;

An iron rebar bears S89°37'53"E, 29.15 feet;

An iron rebar bears S0°18'02"E, 30.45 feet;

NAD 83/1991 State Plane Coordinate

The monument and references were tied using a Trimble R7/R8 RTK GPS system.

Location and comments

**Compass Declination** 

**Surveyors Seal** 

REGISTERED

Oregon North Zone

N = 827957.99 ift

E = 8748835.74 ift

= 8748835.74 ITT

Firm / Agency

Witness Tree Surveying

Address

P.O. Box G

Pilot Rock, Or. 97868

Party Chief

Stephen K, Haddock

PROFESSIONAL LAND SURVEYOR

OREGON
JULY 9, 2001
STEPHEN K. HADDOCK

RENEWAL DATE 6-30-13

56295LS

RECEIVED BY:

Umatilla County Surveyor

No. 12-155-18