## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Section Corner common to Sections | \$ 2, Township 5 North, Range 37 East, and Sections 35 \$ 36, Township 6 North, Range 37 East, all in the Willamette Meridian, Umatilia County, Oregon.

A-21

History of original corner establishments

William H. Odell & William S. Lewis, Deputy Surveyors, Contract No. 110, 07 February, 1865:

"Set a post, corner for sections 1, 2, 35 \$ 36, from which

A Larch 18 in. dia., bears N48°W, 8 iks. dist.

A Larch 18 in. dia., bears 953°N, 92 ike. diet. A Larch 20 in. dia., bears 912°E, 30 ike. diet.

A Larch 20 In. dia., bears N54°E, 34 lks. dist."

## Description of evidence founds

Bert Udell, Sept. II, 1956:

"I have had occasion to locate and re-witness the following corner in T 6 N, Range 37 East, W.M. in Umatilla county:

SM Sec Cor., Sec. 36, T 6 N, R 37 E.

18" Larch N 49 W 5.8 ft. Rotted-gone 18" Larch S 53 M 21.2 ft. Non enag-ecribe visible 20" Larch S 12 E 19.8 ft. Rotted stub 20" Larch N 54 E 22.4 Pt. There is a gear on a shaft for this corner and I put a tag on road about 300 ft. east of here."

Gregory A. Crites, R.P.L.S. Ore. 1887

John Hopkins, headchain: August 7, 1992: I found the rotten snag remains of the original 18" dia. Larch 953°W 32 lks. diet. (21.2 ft.) with 18" dia. Larch \$55°W 32 lks. diet. (21.2 ft.) with cruisers mark "T" and old face with scribing rotted away lying face down on the ground. An old Yellow Metal "Walla Lumber Company" location poster was attached to this rotten log, as well as a U.S. Forest Service "Survey Monument" sign, attached by someone with the initials "RCO" in 1980 (no record).

The original 20" Larch N54°E 34 lks. diet. (22.4 ft.) is a blown over snag which has been completely.

ft.) is a blown over snag which has been completely eaten by carpenter ants. Face down, there is evidence of an old face but no marks of any kind can be found. The original 20" Larch SI2°E 30 lks. dist. (19.8

ft.) is now a badily decayed stump which has been torn out of the ground by bears and is laying pointing southeast, with no evidence of marks.

The original 18" Larch N48°W 8 lks. dist. (5.3

ft.) is now a rotten mound of earth.

A very ancient fence corner lies immediately south of the corner position, with wires grown into the center of a badly decayed stump. I traced this fenceline with a metal detector for a distance of 300 ft., more or less southerly of this position. All wires are buried.

The gear on a shaft referred to by Udell has been pulled out of the ground and stuck at random in the vicinity of the original position. It is loose in the ground. I did not consider its position stable enough to tie to as a bearing object.

A tractor axie of unknown origin lies \$44°38'48"E a distance of 60.68 feet from the monumented position,

at the southerly end of a north/south barbed nire fence of fairly recent origin.

REGISTERED **PROFESSIONAL** LAND SURVEYOR

OREGON JULY 26, 1988 PAUL W.P. TOMKINS 2360

ur

S/16/92 Umatilla County Surveyor RECEIVED BY Office of County of , I hereby certify that the within instrument was filed in this office for record on the \_ day of . (COUNTY OFFICIAL) (DEPUTY)

Page | of 2

3


## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Section Corner common to Sections I & 2, Township 5 North, Range 37 East, and Sections 35 & 36, Township 6 North, Range 37 East, all in the Millamette Meridian, Umatilla County, Oregon.

History of original corner establishment:

Description of evidence found (continued).

When we originally visited this corner on July 6, 1942, we presumed that the tractor axis in the fenceline was the corner position, but could find no supporting original evidence for its position. In the course of completing our survey, we commenced to mark bearing trees relative to this tractor axis, only to discover the original evidence while marking these trees. I removed the faces of these trees with a power saw, but the scars will remain. They are not to be construed as witnesses to any corner position nor as validating the position of the tractor axis of unknown origin in the fenceline. A record of their position relative to the tractor axis is on file in our office.

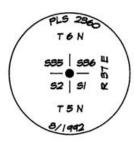

Description of monument and accessories I established to perpetuate the original location of this corner:

At the 6LO record bearing and distance from the found remains of the original lô in. dia. Larch 959°M 21.2 feet, I set a standard I' dia. "Hoffland" galvanized iron pipe with 2-1/2" Bronze cap marked as shorn, from which:

An 8 in. dia. Western Larch bears N56°15W, a distance of 21.2 feet to center, with face mkd. "T6NR5TESS55". I set an Aluminum nail in 3/4" Brass washer mkd. "WA 25693 OR 2560" in the center of the "B" on the scribed face, which is typical for all bearing trees established in this restoration.

A 16-1/2 in. dia. Engelman Spruce bears N57°E, a distance of 42.7 feet to center, with face mkd. "T6NR37E336BT". The north/south barbed wire fence running out of the tractor axle of unknown origin referred to previously is attached to this tree.

A l6 In. dia. Grand Fir bears \$29°80'E, a distance of 21.2 feet to center, with face mkd. "T5NR9TESIBT".

An 8 in. dia. Mestern Larch bears 518°W, a distance of 17.5 feet to center, with face mkd. "T5NRSTES2BT".

I affixed Umatilla County Surveyor Yellow Metal Bearing Object signs to the new bearing trees. I also affixed Yellow Metal Bearing Tree signs (penalty for disturbance, etc.) to each new tree.

Bearings are magnetic using a "Silva Ranger" compass, with a declination of 19°E, calibrated to true bearing by Solar observation.

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON

JULY 26, 1988 PAUL W.P. TOMKINS 2360

8/25/92

		RECEIVED BY
	unty of	Heatill G
filed in this office for record on the d	the within instrument was ay of, 19, ou	Date 9-92
(COUNTY OFFICIAL)	(DEPUTY)	Rec'd by
Page 2 of 2		No. 92-126-C