RECORD OF SURVEY

RECOVER AND OR REPLACE THE PUBLIC LAND CORNERS THAT FALL WITHIN TOWNSHIP 5 NORTH, RANGE 29 EAST OF THE W.M., UMATILLA COUNTY, OREGON.

SURVEYOR'S NARRATIVE

THIS SURVEY WAS UNDERTAKEN IN NOVEMBER OF 2022 AT THE REQUEST OF DAVE KRUMBEIN WITH THE UMATILLA COUNTY SURVEY DEPARTMENT. THE PURPOSE OF THE SURVEY IS TO RECOVER AND OR REPLACE THE PUBLIC LAND CORNERS THAT FALL WITH TOWNSHIP 5 NORTH, RANGE 29 EAST OF THE WILLAMETTE MERIDIAN, UMATILLA COUNTY, OREGON.

TIMOTHY W. DAVENPORT SURVEYED BOTH TOWNSHIP 5 NORTH, RANGE 29 EAST OF THE W.M. AS WELL AS TOWNSHIP 5 NORTH, RANGE 28 EAST OF THE W.M. IN 1881. IN 2005 LS 951 SURVEYED TOWNSHIP 5 NORTH, RANGE 29 EAST OF THE W.M.

PRIOR TO STARTING THIS SURVEY I SET 8 CONTROL POINTS AT A 4 HOUR STATIC SESSION AND THE POST PROCESSING WAS ACCOMPLISHED THROUGH NGS OPUS. EACH OF THE 8 SET CONTROL POINTS WAS THEN OCCUPIED WITH A BASE RECEIVER AND A 3 MINUTE MEASUREMENT WAS THEN MADE TO EACH PUBLIC LAND CORNER UTILIZING A ROVER WITH RTK METHODS.

BELOW IS WHAT I WAS ABLE TO RECOVER AND OR SET AT EACH PUBLIC LAND CORNER THAT FALLS WITHIN TOWNSHIP 5 NORTH, RANGE 29 EAST OF THE W.M.

J1.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST AND NORTHWEST QUADRANTS IN GOOD CONDITION. I SET 2 NEW ACCESSORIES IN THE SOUTHEAST AND NORTHWEST QUADRANTS.
J3.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST AND SOUTHEAST QUADRANTS IN GOOD CONDITION. I SET 2 NEW ACCESSORIES IN THE SOUTHWEST QUADRANT.
J5.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHEAST, SOUTHWEST AND NORTHEAST QUADRANTS IN GOOD CONDITION.
J25.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHEAST AND NORTHWEST QUADRANTS IN GOOD CONDITION.
L1.....THE LOCATION OF THIS CORNER FALLS IN A POND. I RECOVERED THE ACCESSORIES IN THE NORTHWEST, NORTHEAST ND SOUTHEAST QUADRANTS IN GOOD CONDITION. I SET A NEW ACCESSORY IN THE SOUTHWEST QUADRANT.
L5.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN NORTHEAST, NORTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
L9.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHWEST, SOUTHEAST, NORTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
L13.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHWEST QUADRANT IN GOOD CONDITION. I SET 2 NEW ACCESSORIES IN THE NORTHWEST AND NORTHEAST QUADRANTS.
L17.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN SOUTHEAST, NORTHEAST AND NORTHWEST QUADRANTS IN GOOD CONDITION
L21.....RECOVERED A CONCRETE PILLAR THAT WAS THE LOCATION OF THIS CORNER. I RESET THIS MONUMENT BASED UPON THE FOUND ACCESSORIES IN THE NORTHEAST, NORTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
L25.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST AND NORTHWEST QUADRANTS IN GOOD CONDITION. I SET A NEW ACCESSORY IN THE NORTHWEST QUADRANT.
N1.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, NORTHWEST, SOUTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
N3.....RECOVERED THIS MONUMENT LAYING ON THE GROUND AND RESET ITS LOCATION FROM THE FOUND ACCESSORIES. I RECOVERED ITS ACCESSORIES IN THE NORTHEAST AND NORTHWEST QUADRANTS IN GOOD CONDITION.
N5.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHWEST, NORTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
N7.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHWEST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
N9.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, SOUTHWEST AND NORTHWEST QUADRANTS IN GOOD CONDITION.
N11.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, NORTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
N13.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHWEST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
N15.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST AND NORTHWEST QUADRANTS IN GOOD CONDITION.
N17.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHEAST, NORTHWEST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
N19.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
N21.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, NORTHWEST, SOUTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
N23.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, NORTHWEST, SOUTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
N25.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
P1.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHWEST AND NORTHEAST QUADRANTS IN GOOD CONDITION. I SET 2 NEW ACCESSORIES IN THE SOUTHEAST AND NORTHEAST QUADRANTS.
P5.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, NORTHWEST, SOUTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
P9.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHEAST QUADRANT IN GOOD CONDITION.
P13.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, NORTHWEST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
P17.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, NORTHWEST, SOUTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
P21.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHWEST, AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
P25.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, SOUTHWEST, AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
R1.....RECOVERED THIS CORNER AND ITS ACCESSORIES IN THE NORTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION. I SET AN ACCESSORY IN THE SOUTHWEST QUADRANT.
R3.....RECOVERED THIS CORNER AND ITS ACCESSORIES IN THE NORTHEAST, SOUTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION. I SET AN ACCESSORY IN THE NORTHEAST QUADRANT.
R5.....RECOVERED THIS CORNER AND ITS ACCESSORIES IN THE NORTHWEST, SOUTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION. I SET AN ACCESSORY IN THE NORTHEAST QUADRANT.
R7.....RECOVERED THIS CORNER AND ITS ACCESSORY IN THE NORTHWEST QUADRANT IN GOOD CONDITION. I SET AN ACCESSORY IN THE NORTHEAST AND SOUTHWEST QUADRANTS.
R9.....RECOVERED THIS CORNER AND ITS ACCESSORIES IN THE SOUTHEAST AND NORTHEAST QUADRANTS IN GOOD CONDITION. I SET AN ALUMINUM CAP AT THE LOCATION OF A FOUND 2" IRON PIPE AND ACCESSORY IN THE NORTHWEST QUADRANT.
R11.....RECOVERED THIS CORNER AND ITS ACCESSORIES IN THE NORTHEAST, SOUTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION, I SET AN ACCESSORY IN THE SOUTHEAST QUADRANT.
R13.....RECOVERED THIS CORNER AND ITS ACCESSORIES IN THE NORTHEAST AND NORTHWEST QUADRANTS IN GOOD CONDITION. I SET 2 ACCESSORIES IN THE SOUTHEAST AND SOUTHWEST QUADRANTS.
R15.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
R17.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHEAST AND NORTHWEST QUADRANTS IN GOOD CONDITION.
R19.....RECOVERED THIS CORNER AND ITS ACCESSORIES IN THE SOUTHWEST QUADRANT IN GOOD CONDITION. I SET 3 ACCESSORIES IN THE SOUTHEAST QUADRANT,
R21.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, SOUTHEAST, SOUTHWEST AND NORTHWEST QUADRANTS IN GOOD CONDITION.
R23.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION. I SET 2 ACCESSORIES IN THE NORTHEAST AND SOUTHWEST QUADRANTS.
R25.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, SOUTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
T1.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHWEST, SOUTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION. I SET AN ACCESSORY IN THE NORTHEAST QUADRANT.
T5.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHEAST, NORTHWEST AND SOUTHWEST QUADRANTS IN GOOD CONDITION. I SET AN ALUMINUM CAP AT THE LOCATION OF A FOUND 1/2 INCH IRON ROD.
T9.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, NORTHWEST, SOUTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
T13.....RECOVERED THIS CORNER IN GOOD CONDITION. I SET 4 ACCESSORIES IN THE NORTHWEST, NORTHEAST, SOUTHWEST AND SOUTHEAST QUADRANTS.
T17.....THE LOCATION OF THIS CORNER FALLS INSIDE A STORAGE SHED. I RECOVERED ITS ACCESSORIES IN THE NORTHEAST, NORTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
T21.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, SOUTHWEST AND NORTHWEST QUADRANTS IN GOOD CONDITION.
T25.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, NORTHWEST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
V1.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, NORTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
V3.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHWEST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
V5.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION, I SET AN ACCESSORY IN THE NORTHEAST QUADRANT.
V7.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, SOUTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
V9.....DID NOT EXPOSE THIS MONUMENT IN A BUSY INTERSECTION YET I DID LIGHT UPON IT WITH A METAL LOCATOR. I RECOVERED IT ACCESSORIES IN THE NORTHWEST AND NORTHEAST QUADRANTS. I SET 2 ACCESSORIES IN THE SOUTHEAST QUADRANT.
V11.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHWEST, SOUTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION. I SET AN ACCESSORY IN THE NORTHEAST QUADRANT.
V13.....RECOVERED A 5/8" IRON ROD WITH A MISSING CAP ALONG WITH ITS ACCESSORIES IN THE NORTHWEST, NORTHEAST AND SOUTHEAST QUADRANTS IN GOOD CONDITION. I PLACED A 2" ALUMINUM CAP ON THE 5/8" IRON ROD. I SET AN ACCESSORY IN THE SOUTHWEST QUADRANT.
V15.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, SOUTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION. I SET AN ACCESSORY IN THE NORTHWEST QUADRANT.
V17.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, NORTHWEST, SOUTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
V19.....SEARCHED FOR BUT DID NOT RECOVER THIS MONUMENT, I RESET THIS MONUMENTS LOCATION BASED UPON THE RECOVERED ACCESSORIES. I RECOVERED ITS ACCESSORIES IN THE SOUTHWEST AND SOUTHEAST QUADRANT IN GOOD CONDITION.
V21.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, SOUTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
V23.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST AND NORTHWEST QUADRANTS IN GOOD CONDITION.
V25.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
X1.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, SOUTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION. I SET AN ALUMINUM CAP AT THE LOCATION OF A FOUND 5/8 INCH IRON ROD.
X5.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHWEST, SOUTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION. I SET AN ALUMINUM CAP AT THE LOCATION OF A FOUND 1/2 INCH IRON ROD.
X9.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST AND NORTHWEST QUADRANTS IN GOOD CONDITION. I SET 2 ACCESSORIES IN THE SOUTHWEST AND SOUTHEAST QUADRANTS.
X13.....FOUND A 5/8" IRON ROD WITH ITS ACCESSORIES IN THE SOUTHWEST AND SOUTHEAST QUADRANTS. I PLACED A 2" ALUMINUM CAP ON THE FOUND 5/8" IRON ROD.
X17.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST QUADRANT IN GOOD CONDITION.
X21.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHWEST QUADRANT IN GOOD CONDITION.
X25.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE ACCESSORIES IN THE SOUTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION. I SET AN ALUMINUM CAP AT THE LOCATION OF A FOUND IRON PIPE AND ACCESSORIES IN THE SOUTHWEST AND SOUTHEAST QUADRANTS.
Z1.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHWEST, SOUTHEAST, NORTHWEST, AND NORTHEAST QUADRANTS IN GOOD CONDITION.
Z3.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, NORTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
Z5.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, SOUTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION. I SET AN ACCESSORY IN THE NORTHWEST QUADRANT.
Z7.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION. I SET AN ACCESSORY IN THE NORTHWEST QUADRANT.
Z9.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHEAST, NORTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION. I SET AN ALUMINUM CAP AT THE LOCATION OF FOUND 1/2 INCH IRON ROD AND AN ACCESSORY IN THE NORTHWEST QUADRANT.
Z11.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHWEST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
Z13.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST AND NORTHWEST QUADRANTS IN GOOD CONDITION.
Z15.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHWEST, SOUTHWEST AND SOUTHEAST QUADRANTS IN GOOD CONDITION.
Z21.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE SOUTHEAST QUADRANT IN GOOD CONDITION.
Z23.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHWEST, NORTHEAST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.
Z25.....RECOVERED THIS CORNER ALONG WITH ITS ACCESSORIES IN THE NORTHEAST, NORTHWEST AND SOUTHWEST QUADRANTS IN GOOD CONDITION.

THE BEARINGS AND DISTANCES AS SHOWN HEREON ARE GRID. THE COMBINED SCALE FACTOR IS 0.99995679 AND THE CONVERGENCE (DEGREES) IS 0.92716667 AT CTL #3 AND IS FROM NGS OPUS SOLUTION REPORT DATED MAY 31. 2022. THE SURVEY WAS ACCOMPLISHED UTILIZING 4 TRIMBLE R-8 GNSS RECEIVERS AND 2 TRIMBLE R-10 GNSS RECEIVERS.

LEGEND

○ SET 5/8" X 30" IRON ROD WITH YELLOW PLASTIC CAP. CONTROL POINTS.

✪ FOUND MONUMENT AS NOTED

SURVEYS

( ) LS 951 R.O.S. 06-265-C

< > DAVENPORT CONTRACT #101 1861, T5N, R29E W.M.

< > DAVENPORT CONTRACT #101 1861, T5N, R28E W.M.

> < E.T. ERIKSON 1943

1" = 1500'

BEARINGS & DISTANCES AS SHOWN ARE GRID.

SURVEYOR'S CERTIFICATION

I, BRIT L. PRIMM, A PROFESSIONAL LAND SURVEYOR IN THE STATE OF OREGON HEREBY CERTIFY THAT THIS MAP CORRECTLY REPRESENTS A SURVEY CONDUCTED UNDER MY DIRECT SUPERVISION IN DECEMBER 2022, IN CONFORMANCE WITH THE REQUIREMENTS OF THE SURVEY RECORDING LAW, AS ESTABLISHED BY ORS CHAPTER 92, AND HAVE SET THE PROPER MONUMENTS.

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON
JULY 13, 1999
BRIT L. PRIMM
48509

EXPIRATION DATE: 12/31/24

DATE: 31JAN23

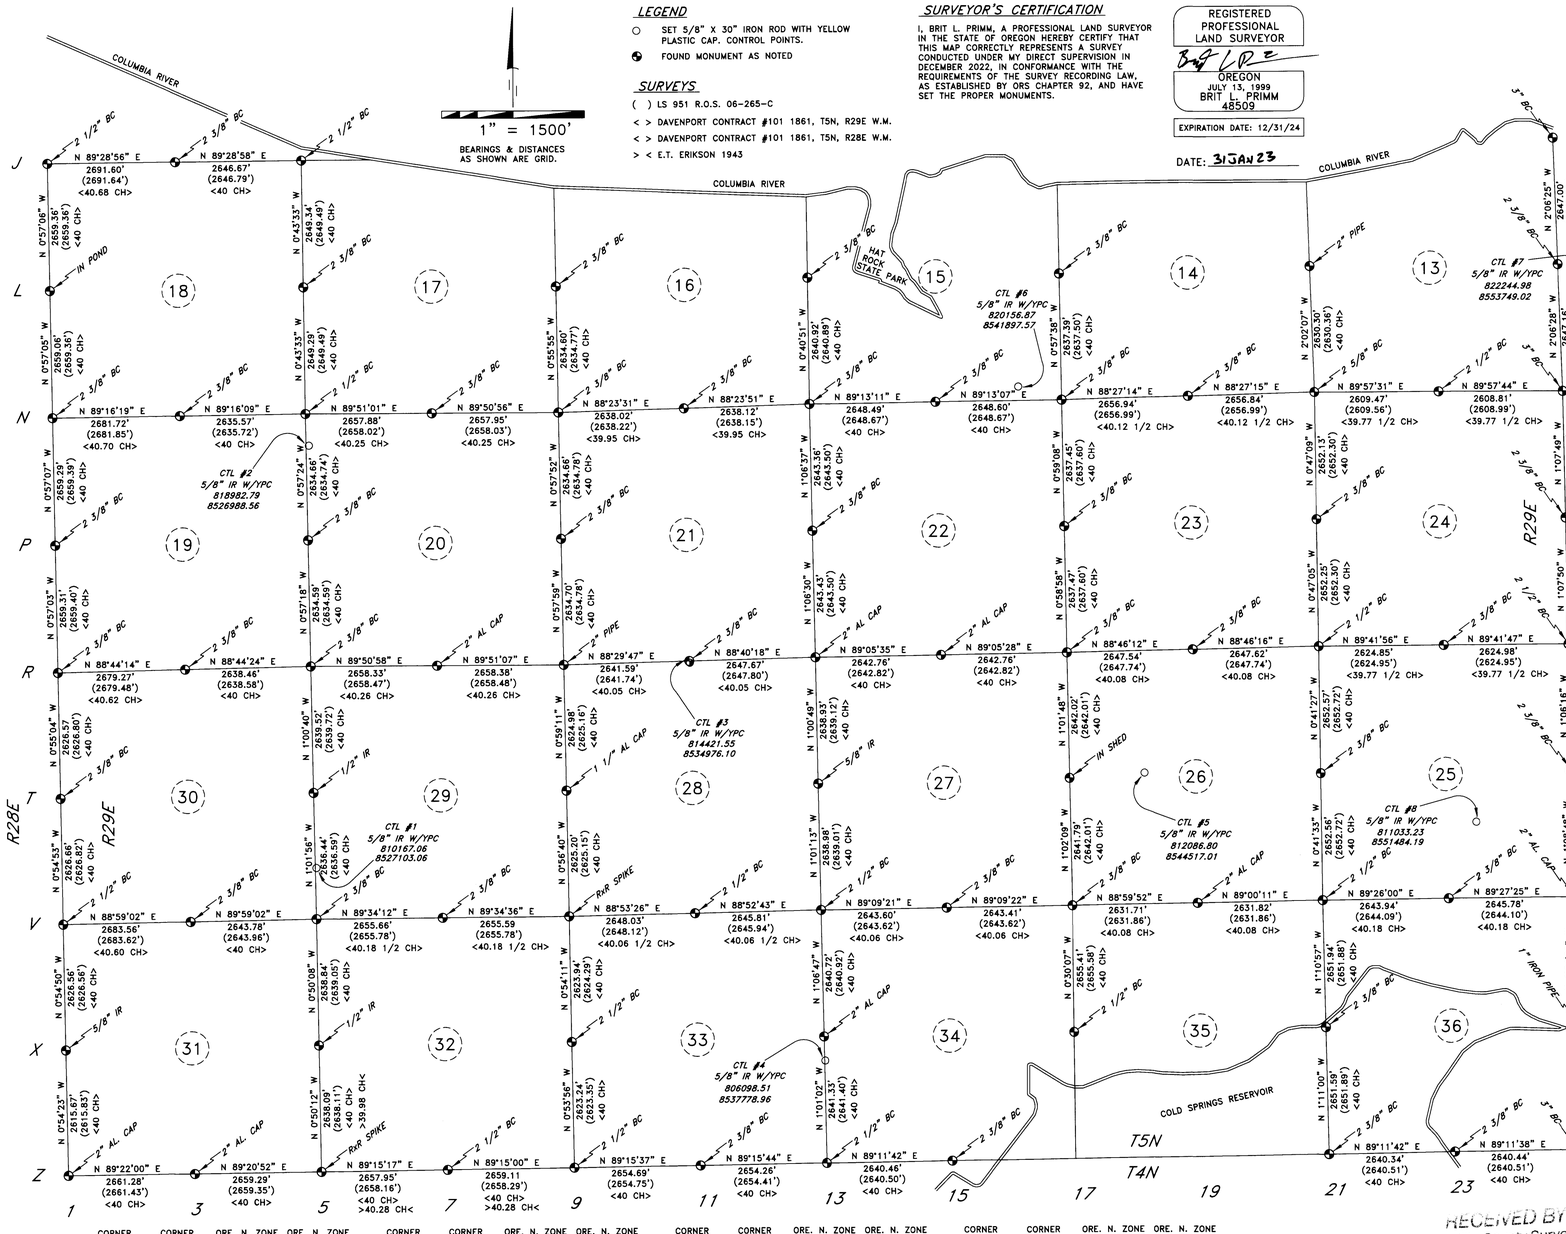

CORNER IDENTIFIER	CORNER DESCRIPTION	ORE. N. ZONE SPC NORTHING	ORE. N. ZONE SPC EASTING
J-1	3" BC	824894.65	8521513.34
J-3	2 3/8" BC	824918.98	8524204.83
J-5	2 1/2" BC	824942.86	8526851.40
J-25	3" BC	825316.16	8553140.44
L-1	IN POND	822235.65	8521557.51
L-5	2 3/8" BC	822293.73	8526884.96
L-9	2 3/8" BC	822292.86	8532191.47
L-13	2 3/8" BC	822447.15	8537477.02
L-17	2 3/8" BC	822515.62	8542760.78
L-21	2" PIPE	822650.61	8548023.43
L-25	2 3/8" BC	822670.95	8553237.75
N-1	2 3/8" BC	819576.96	8521601.66
N-3	2 3/8" BC	819611.04	8524283.16
N-5	2 1/2" BC	819644.66	8526918.52
N-7	2 3/8" BC	819651.60	8529576.39
N-9	2 3/8" BC	819658.61	8532234.33
N-11	2 3/8" BC	819732.64	8534871.31
N-13	2 3/8" BC	819806.42	8537508.40
N-15	2 3/8" BC	819842.49	8540156.64
N-17	2 3/8" BC	819878.61	8542805.00
N-19	2 3/8" BC	819950.30	8545460.97
N-21	2 5/8" BC	820021.97	8548116.84
N-23	2 1/2" BC	820023.86	8550726.31
N-25	3" BC	820025.58	8553335.11
P-1	2 3/8" BC	816918.04	8521645.84
P-5	2 3/8" BC	817010.37	8526962.50
P-9	2 3/8" BC	817024.33	8532278.68
P-13	2 3/8" BC	817163.55	8537559.62
P-17	2 3/8" BC	817241.55	8542850.36
P-21	2 3/8" BC	817370.09	8548153.22
P-25	2 3/8" BC	817385.69	8553387.19
R-1	2 3/8" BC	814259.09	8521689.97
R-3	2 3/8" BC	814318.13	8524368.59
R-5	2 3/8" BC	814376.15	8527006.42
R-7	2" AL. CAP	814383.14	8529664.74
R-9	2" PIPE	814390.01	8532323.11
R-11	2 3/8" BC	814459.33	8534963.79
R-13	2" AL. CAP	814520.71	8537610.75
R-15	2" AL. CAP	814562.54	8540253.17
R-17	2 3/8" BC	814604.47	8542895.60
R-19	2 3/8" BC	814661.30	8545542.54
R-21	2 1/2" BC	814718.08	8548189.54
R-23	2 3/8" BC	814731.87	8550814.36
R-25	2 1/2" BC	814745.79	8553439.29
T-1	2 3/8" BC	811632.86	8521732.04
T-5	1/2" IR	811737.04	8527052.99
T-9	1 1/2" AL CAP	811765.41	8532368.30
T-13	5/8" IR	811882.19	8537657.43
T-17	IN SHED	811962.87	8542943.10
T-21	2 3/8" BC	812065.70	8548221.52
T-25	2 3/8" BC	812105.72	8553490.19
V-1	2 1/2" BC	809006.54	8521773.98
V-3	2 3/8" BC	809054.13	8524457.12
V-5	2 3/8" BC	809101.02	8527100.48
V-7	2 3/8" BC	809120.94	8529756.06
V-9	RxR SPIKE	809140.57	8532411.58
V-11	2 1/2" BC	809191.84	8535059.11
V-13	2 1/2" BC	809243.62	8537704.42
V-15	2 3/8" BC	809282.58	8540347.73
V-17	2 3/8" BC	809321.52	8542990.85
V-19	2" AL. CAP	809367.55	8545622.17
V-21	2 1/2" BC	809413.34	8548253.59
V-23	2 3/8" BC	809439.49	8550897.40
V-25	2 3/8" BC	809464.56	8553543.06
X-1	5/8" IR	806380.31	8521815.87
X-5	1/2" IR	806462.46	8527138.96
X-9	2 1/2" BC	806516.96	8532452.94
X-13	2" AL. CAP	806603.40	8537755.71
X-17	2 1/2" BC	806666.20	8543014.11
X-21	2 3/8" BC	806761.96	8548308.32
X-25	2" AL. CAP	806825.30	8553592.26
Z-1	2" AL. CAP	803764.96	8521857.25
Z-3	2" AL. CAP	803794.38	8524518.37
Z-5	RxR SPIKE	803824.66	8527177.49
Z-7	2 1/2" BC	803859.22	8529835.21
Z-9	2 1/2" BC	803894.04	8532494.09
Z-11	2 3/8" BC	803928.31	8535148.56
Z-13	2 1/2" BC	803962.49	8537802.61
Z-15	2 3/8" BC	803999.59	8540442.81
Z-21	2 3/8" BC	804110.94	8548363.08
Z-23	2 3/8" BC	804148.03	8551003.16
Z-25	3" BC	804185.18	8553643.34

RECEIVED BY
Umatilla County Surveyor
Date: 2/1/23
Rec'd By: CT
No: 23-012-C

PRIMM LAND SURVEYING, INC.
P.O. BOX 1322, 1340 N.E. 4TH
HERMISTON, OR 97838
BUI (541) 564-7887
FAX (541) 567-8020
brit@primmlandsurveying.com
keith@primmlandsurveying.com

CLIENT: *UMATILLA COUNTY*

TOWNSHIP 5 NORTH RANGE 29 EAST OF THE W.M.

PROJECT:
RECOVER AND OR REPLACE THE PUBLIC LAND CORNERS THAT FALL WITHIN TOWNSHIP 5 NORTH, RANGE 29 EAST OF THE W.M., UMATILLA COUNTY, OREGON.

JOB #:	2211001
DATE:	14 DEC 22
FB/PG:	N/A
SHEET:	1 OF 1
DRAWN:	BLP
APPROVED:	BLP