

OREGON CORNER RESTORATION FORM

Section 31 Township 1N Range 32E
 County Umatilla Date: September 18, 2009

Corner Designation: 1N32X1

Quarter corner to section 36, R31E, and Section 31, R32E,
 T1N, W.M., Umatilla County, Oregon



Condition Report Only
 Not found _____
 Remonumented x
 Unrecorded _____
 Surveyed in x
 Referenced out x

Previous Renewals / Surveys, etc.

Corner originally set by Josiah A. Burnett under contract No. 92 Dated September 12, 1860.
 His record reads: Set a post for 1/4 sec. cor., drove charred stake and raised mound with trench
 as per instructions.

Monument and Accessories found: (condition and source)

None. The corner point falls where the old road ends in a plowed field.

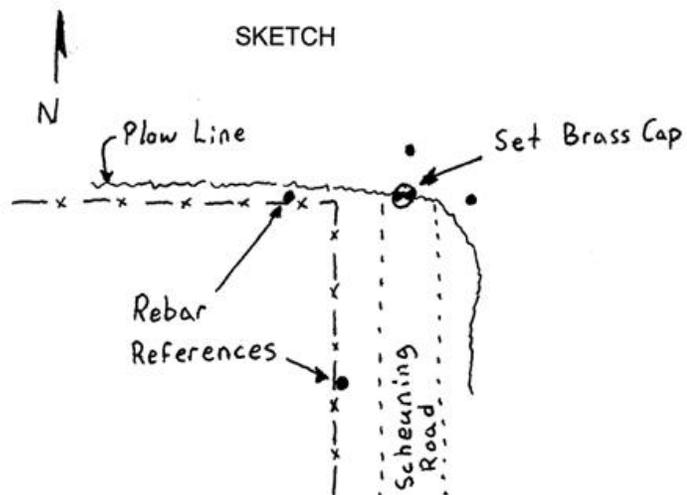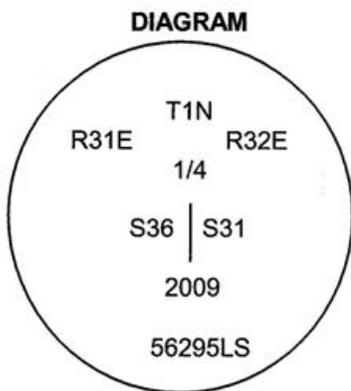

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)

Set a 1 1/2" x 30" galvanized iron pipe with a 2 1/2" brass cap stamped as shown in the diagram above at the intersection of the road centerline running South and a fence running West. The cap is 24" below the surface of the plowed field.

For references, I set four 5/8" by 24" iron rebars with 1 1/4" Orange plastic caps stamped WTS and 56295LS as described below:

- an iron rebar bears N88°00'12"W, 24.04 feet;
- an iron rebar bears N00°03'46"W, 27.98 feet 20 inches below the surface of the field;
- an iron rebar bears N89°53'27"E, 24.61 feet 20 inches below the surface of the field;
- an iron rebar bears S13°46'15"W, 78.42 feet;

The monument and references were tied using a Trimble R7/R8 RTK GPS system.

Location and comments
 NAD 83/1991 State Plane Coordinate
 Oregon North Zone
 N = 680,825.37 ift
 E = 8,619,472.52 ift

Compass Declination

Surveyors Seal

RECEIVED BY:
 Umatilla County Surveyor
 Date: 6-10
 Rec'd By: KF
 No. 10-93-C

Firm / Agency
 Witness Tree Surveying
 Address
 P.O. Box G
 Pilot Rock, Or. 97868
 Party Chief
 Stephen K, Haddock

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

Stephen K. Haddock

OREGON
 JULY 9, 2001
 STEPHEN K. HADDOCK
 56295LS

RENEWAL DATE 6-30-11