## OREGON CORNER RESTORATION FORM


Section Township 1N Range 32E County Umatilla Date: September 10, 2009 Condition Report Only Corner Designation: 1N32R15 Not found Remonumented Quarter corner common to sections 22 and 27. Unrecorded T1N, R32E, W.M., Umatilla County, Oregon. Surveyed in Referenced out

Previous Renewals / Surveys, etc.

Corner originally set by Daniel Chaplin under contract No. 107 dated September 21, 1864. His record reads: Set post for 1/4 sec. corner from which a birch, 10 ins. diam., bears S. 60° E. 7 lks. dist. A yellow wood 4 ins. diam. bears N. 45° W. 8 lks. dist.

Monument and Accessories found: (condition and source)

None. This point falls in a farmed field. Also, the Army Corps of Engineers removed all of the riparian vegetation along this creek in the 1960's and channelized the creek.

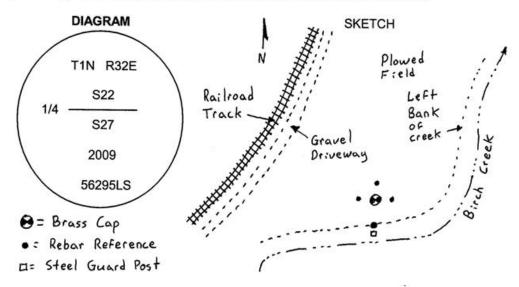

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)
I set a 1 1/2" x 30" galvanized iron pipe with a 2 1/2" brass cap stamped as shown in the diagram above at the proportioned point. The cap is 24 inches below the surface of the plowed field.

For references, I set four 5/8" by 24" iron rebars with 1 1/4" orange plastic caps stamped WTS and 56295LS as described below:

an iron rebar bears N89°14'03"W, 24.22 feet, 2 feet below the surface of the field; an iron rebar bears N05°23'13"E, 25.67 fee, 2 feet below the surface of the fieldt; an iron rebar bears N88°53'32"E, 25.58 feet, 2 feet below the surface of the field; an iron rebar bears S03°08'45"W, 62.89 feet;

The monument was set and references were tied using a Trimble R7/R8 RTK GPS system.

Location and comments Compass Declination Surveyors Seal NAD 83/1991 State Plane Coordinate Oregon North Zone REGISTERED N = 689,087.12 ift PROFESSIONAL E = 8,638,303.15 ift Firm / Agency LAND SURVEYOR Witness Tree Surveying RECEIVED BY: Address Umatilla County Surveyor P.O. Box G OREGON Date: Pilot Rock, Or. 97868 JULY 9, 2001 IEN K. HADDOCK Rec'd By: KK Party Chief 10.93.C Stephen K, Haddock RENEWAL DATE 6-30-11