


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner not previously established

Corner position previously calculated by William R. Wells in survey 10-131-B. No monument set.

T 1 N R 35 E L-07

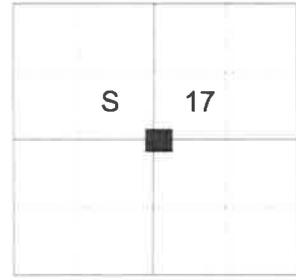

DESCRIPTION OF CORNER EVIDENCE FOUND:

None

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At position determined by survey, I set a 2 1/2"x30" aluminum pipe with 2 1/2" aluminum cap, marked as shown below, 29 inches in the ground, from which:

NEW BEARING OBJECTS:

A 8" Douglas Fir bears South 86° East, a dist. of 32.25 ft., marked "C1/4 S17 BT".

A 27" Douglas Fir bears North 10° East, a dist. of 14.05 ft., marked "C1/4 S17 BT".

A 11" White Fir bears South 25° West, a dist. of 34.80 ft., marked "C1/4 S17 BT".

A 12" White Fir bears North 75° West, a dist. of 75.70 ft., marked "C1/4 S17 BT".

I set a steel fencepost approximately 1 ft. North of corner monument.


The North, South and West running fence corner bears approximately 30' NW of the set monument.

I hereby certify that the corner was monumented on July 20, 2018.

Witness: Ryan Skeen and Jeff Hsu



Renewal Date: June 30, 2019

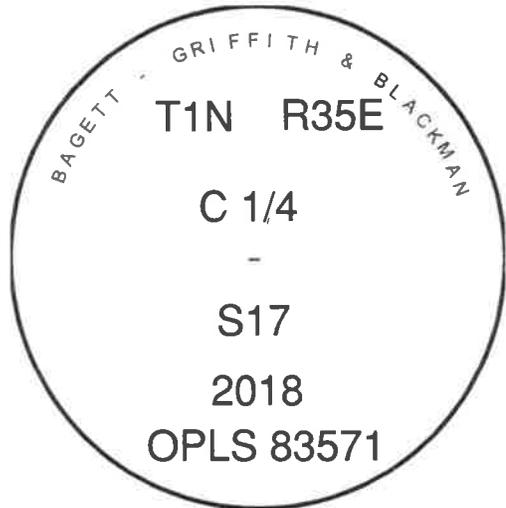

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 13° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.