


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by Currin and Noland under GLO contract dated May 4th 1887. Field notes state:
Set Stone 18 x 8 x 8 ins. 12 ins. in the ground for 1/4 sec. cor. marked 1/4 S on West face from which:
A hemlock 10 ins. Diam. Bears S 15° E 56 lks. Dist. Marked 1/4 S.B.T.
A hemlock 16 ins. Diam. Bears S 60° W 28 lks. Dist. Marked 1/4 S.B.T.

T 1 N R 35 E L-13

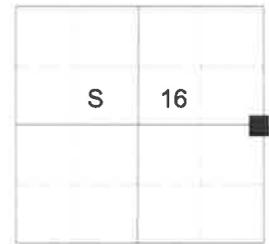

DESCRIPTION OF CORNER EVIDENCE FOUND:

No original corner evidence found.

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At proportionate position, I set a 2 1/2" x 30" Aluminum Pipe, 24" in the ground with a 2 1/2" Aluminum cap marked as shown below, in a collar of stone 1 ft. diam., from which:

NEW BEARING TREES:

A 10" Western Larch bears North 75° East, a distance of 28.85 feet, marked 1/4 S15 BT.
A 9" Douglas Fir bears South 60° East, a distance of 12.60 feet, marked 1/4 S15 BT.
A 4" White Fir bears South 65° West, a distance of 19.21 feet, marked 1/4 S16 BT.
A 20" Douglas Fir bears North 2° West, a distance of 15.90 feet, marked 1/4 S16 BT.


Set steel fencepost approximately 1' South.

I hereby certify that the corner was monumented June 29, 2017.

Witness: Kyle Tucker



Renewal Date: June 30, 2019

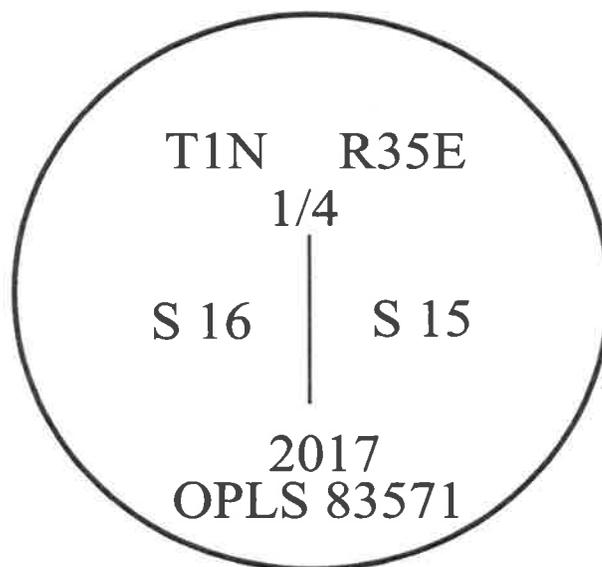

I used a steel tape and magnetic compass in the establishment of the bearing trees. Magnetic declination used was 13° East. Bearings are to a brass washer marked OPLS 83571 in the lower blaze of the tree. Distance is to a spike set in the root crown of the side of the tree.