


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by Currin and Noland under GLO contract dated May 4th 1887. Field notes state:
Set Stone 9x8x7 ins. 6 ins. in the ground for 1/4 Sec. cor. marked 1/4 on N face, raised mound of stone over it. Pits impracticable.

T 1 N R 35 E N-11

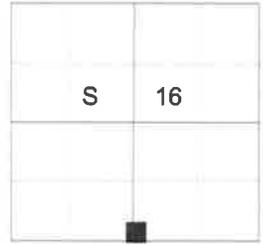

DESCRIPTION OF CORNER EVIDENCE FOUND:

No original corner evidence found.
From a proportionate position, a ponderosa pine tree bears Northerly, approx 119 feet with BIA k-tag (marks illegible) and Valsetz Lumber tag marks '1.17 chs. S'. No other evidence found.

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At proportionate position, I set a 2 1/2" x 30" Aluminum Pipe, 10" in the ground, to bedrock, with a 2 1/2" Aluminum cap marked as shown below, in a collar of stone 1 1/2 ft. diam., from which:


NEW BEARING TREES:

- A 5/8" x 15" rebar bears North 42°53' East, a distance of 16.01 feet, marked BGB SURVEY MARKER NE RP.
- A 5/8" x 15" rebar bears South 66°35' East, a distance of 14.52 feet, marked BGB SURVEY MARKER SE RP.
- A 5/8" x 15" rebar bears South 64°33' West, a distance of 9.08 feet, marked BGB SURVEY MARKER SW RP.
- A 5/8" x 15" rebar bears North 35°53' West, a distance of 18.65 feet, marked BGB SURVEY MARKER NW RP.

I hereby certify that the corner was monumented June 18, 2017.



Renewal Date: June 30, 2019

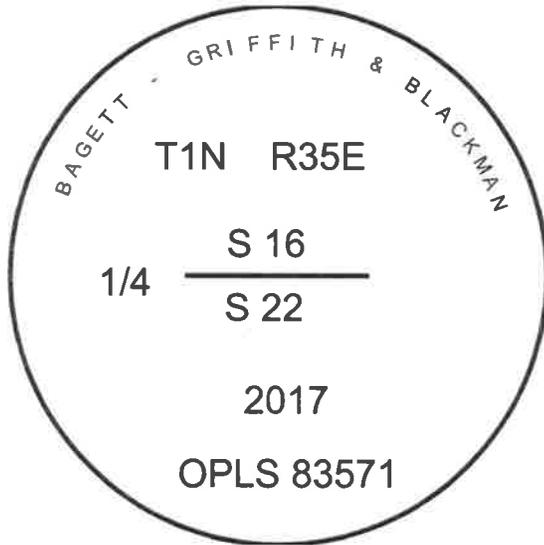

I used an RTK GPS in the establishment of the accessories. Basis of bearing is as per survey for Hancock Forest Management, dated July 2017. Bearings and distances are to the center of the aluminum caps.