


**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

**HISTORY OF ORIGINAL CORNER ESTABLISHED:**

Corner originally established under GLO Special contract, dated May 4, 1887, executed by James P. Currin and James E. Noland. Surveyor General field notes state:

Set a basalt stone 9x8x7 ins. 6 ins. in the ground for 1/4 Sec. Cor. mkd 1/4 on W. face, from which:  
A Pine 24 ins. in diam. bears S45°E, 5 lks dist. mkd. 1/4 S. BT.  
A Pine 16 ins in diam. bears N85°W, dist 10 lks. mkd. 1/4 S. BT.

T 1 N R 35 E T-01

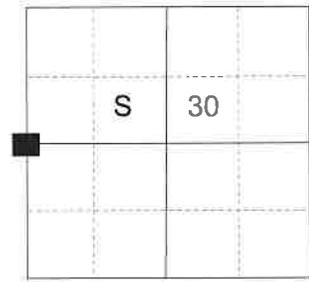

**DESCRIPTION OF CORNER EVIDENCE FOUND:**


Found a rotting stump, 5 ft. high and 18" in diameter, with scribe marks 1/4 and BT visible on double blaze. A stone, 5x8x13, marked 1/4 bears N12°W, 4' dist. Not accepted due to size.

**DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:**

At record bearing and distance from found BT, I set a 2 1/2" x 30" aluminum pipe, 24" in the ground, with 3" aluminum cap, marked as shown below, in a collar of stone 1 1/2" diameter, from which:


**NEW BEARING OBJECT:**

A 9" Douglas Fir bears North 60° East, a distance of 8.20 feet, marked 1/4 S30 BT.  
A 6" Douglas Fir bears South 40° East, a distance of 25.00 feet, marked 1/4 S30 BT.  
An 8" White Fir bears South 10° West, a distance of 6.70 feet, marked 1/4 S25 BT.  
A 13" Douglas Fir bears North 26° West, a distance of 21.70 feet, marked 1/4 S25 BT.

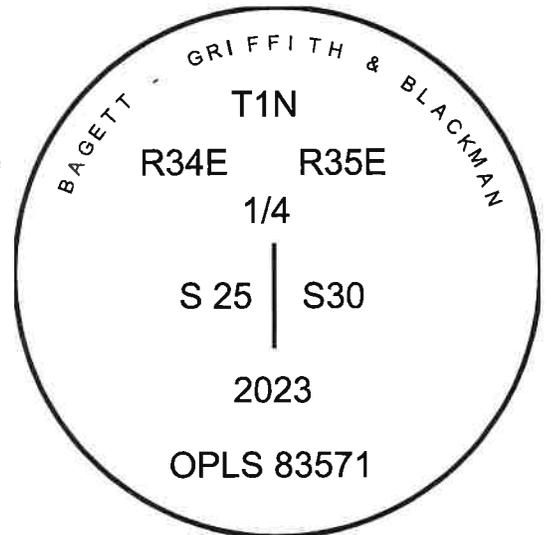

I hereby certify that the corner was monumented on October 31, 2023.

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

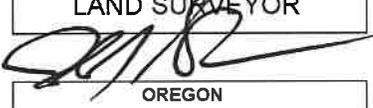

OREGON  
June 2, 2010  
JEFFREY S. HSU  
83571

Renewal Date: June 30, 2025

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 14° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.