OREGON CORNER RESTORATION FORM

T1S R29E G5

Section _7_. Township 15. Range 29E Date __April 6. 2005. County Morrow

The quarter corner common to Sections 7 & 8. T1S R29E, W.M., Morrow County, Oregon.

Condition Report

__ Not Found

Remonumented X_

Unrecorded Surveyed in


Referenced out

Previous Renewals / Surveys, etc.

The corner was originally set by George Williams under Contract No. 154 dated April 6, 1872. His record Reads: Set a stone 22 x 7 x 6 on S.W. hillside for 1/4 Sec. cor.

Monument and accessories found: (Condition and source)

I found the basalt stone set by Williams firmly in place in a small bit of tailless rock at the bottom of a small rock outcrop. The stone was very plainly marked 1/4.

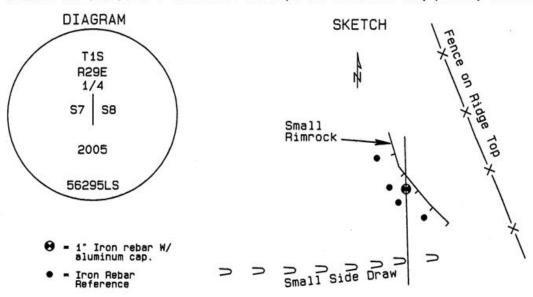

Monument and accessories set: (Procedures and description) At the position of the original stone I set a 1" x 24" iron rebar with a 2" AL cap stamped as shown above. I drove the rebar to the bedrock and covered it with the tailless rock. I buried the original stone on the east side of the rebar.

For references I set four 5/8" x 18" iron rebars with 1.25" orange plastic caps stamped WTS and 56295LS 2" below the surface:

an iron rebar bears S33 *03 *57 *E 66.13 feet; an iron rebar bears S30 *06 11 *W 30.23 feet; an iron rebar bears N84 *21 42 *W 33.38 feet;

an iron repar bears N43 *55'27"W 84.28 feet;

The monument and references were set and tied using a Trimble R7/R8 GPS system and static surveying methods. Bearings and distances are Grid.

Location and Comments SPC Oregon North, NAD 83-91

Northing = 668, 994.12 ift

= 8,522,623.63 ift

Witnessed By:

Easting

RECEIVED BY: Umatilla County Surveyor

5-05 Date: Rec'd By: VK

05-111-0

Compass Declination

Firm / Agency Witness Tree Surveying P.O. Box G Pilot Rock, OR 97868 Party Chief

Stephen K. Haddock, PLS

Surveyor's Seal

REGISTERED **PROFESSIONAL** LAND SURVEYOR

OREGON JULY 9, 2001 STEPHEN K, HADDOCK

RENEWAL DATE 6-30-05