## OREGON CORNER RE\_FORATION FORM


Section	4	Township	28	Range	32E	
County	Umatilla	_ Date:	April 25, 1	997		
Corner Designation: 2S32 A13						Condition Report Only Not found
Corner to sections 33 and 34 T1S, R32E W.M. and sections 3 and 4 T2S, R32E, W.M.					x	Remonumented Unrecorded Surveyed in
					x	Referenced out

Previous Renewals / Surveys, etc.

Corner originally set by David P. Thompson under contract No. 106 Dated August 16, 1864. His record reads: Set stone, 24 x 12 x 8 ins. for corner to sections 3, 4, 33, and 34.

Monument and Accessories found: (condition and source)

A stone of record dimensions was found firmly in place buried vertically with one third of its length above the ground at the foot of a rock jack at a fence intersection with fence running North, South, and West. There were no marks visible on the stone.

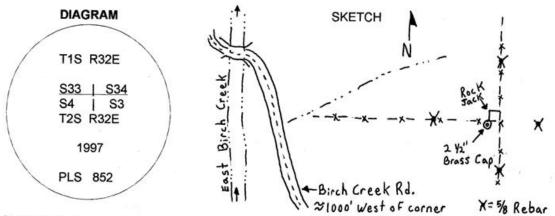

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)
Set a 1 1/4" x 30" Galvanized Iron Pipe with a 2 1/2" brass cap stamped a shown in the diagram above at the position of the record stone. Raised a mound of stone around the monument.

For references, I set four 5/8" by 24" rebars with 1.25" red plastic caps stamped ORLS 852 and WALS 13922 as described below:

- a rebar bears N10°27'E, 28.50 feet under the existing fence;
- a rebar bears S87°39'E, 27.17 feet;
- a rebar bears S05°21'E, 43.67 feet under the existing fence;
- a rebar bears N86°55'W, 16.34 feet under the existing fence;

Monument and reference locations were surveyed with GPS recievers in stop and go mode.

The bearings are true. The distances are grid.

Location and comments Compass Declination Surveyors Seal Firm / Agency Haddock Surveying REGISTERED Address PROFESSIONAL LAND SURVEYOR RECEIVED BY: P.O. Box 1574 Umatilla County Surveyor Pendleton, Or. 97801 David b. Haddock Date: Party Chief Rec'd By: A Stephen K, Haddock OREGON DAVID L. HADDOCK RECEIVED BY Umatilla County Surveyor

Date

No.

Rec'd by

REFER to 97-109-B