CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner was originally established by Jacob C. Cooper under GLO Contract No. 397, dated July 1, 1881. Surveyor General records state:

A fir 5 ins diam which I marked for cor to secs 1, 6, 7 and 12, T1S S6 on NE, R37 S7 on SE, R36 S12 on SW and S1 on the NW faces with 5 notches on the S and 1 notch on the N edges, from which; A pine 7 ins diam bears S80°E 7 lks dist marked T1S R37E S7 RT. A pine

bears S80°E 7 lks dist marked T1S R37E S7 BT. A pine 4 ins diam bears N45°E 5 lks dist marked T1S R37E S6 BT. A pine 12 ins diam bears S66°W 15 lks dist marked

T1S R36E S12 BT. A pine 12 ins diam bears N19°W 21 lks dist marked T1S R36E S1 BT.

See sheet 2 for additional history records.

E-25 DIAGRAM T1S. R36E R37E S 1 RM S 6 4.0 S 12 1989 OPLS 644

Description of corner evidence found:

Found a 20" white fir corner tree, from which: A $2\frac{1}{2}$ " aluminum cap on a $2\frac{1}{2}$ " aluminum pipe reference monument protruding 1" out of ground, marked as shown in corner diagram, bears North, 4.0 feet.

An 18" white fir stump, uprooted, bears N 83° E (m/1) - 12 feet, healed blaze. A 22" white fir stump, uprooted, bears S 25° W (m/1) - 23 feet, healed blaze.

A 12" dead lodge pole pine bears N 20° W - 14.2 feet, visible scribing, 13.8 feet to face.

Description of monument and accessories I established to perpetuate the original location of this corner:

5.0' North of corner tree set steel fence post with 54-2 and 54-9 signs attached, 1.0 feet North of reference monument.

A 5/8" x 30" iron pin with yellow plastic cap bears N 58° W - 20.7 feet. A 5/8" x 30" iron pin with yellow plastic cap bears S 17° W - 17.8 feet. A 5/8" x 30" iron pin with yellow plastic cap bears S 65° W - 27.5 feet. All iron pins have 54-3 signs attached and steel fence posts near with 54-9 sign attached. Bearings and distances to corner.

I hereby certify that the above corner monument was properly maintained to U.S.F.S. standards by me on August 2, 1994.

Compass declination 18° East.

Sheet 1 of 2 (continued on page 2)

REGISTERED
PROFESSIONAL
LAND SURVEYOR

WILL. R. WILLS

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106


| Office of Surveyor | county of Omatilla |
|----------------------------------|---|
| State of Oregon I hereby certify | that the within instrument was filed in this office |
| for second on the 2 day of Decem | OTV, 1994 |
| (COUNTY OFFICIAL) | RECEIVED BY |

Form R6-7100-57 (9/71)

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Corner History Continued: History of original corner establishment:

Corner resurveyed by Henry Meldrum under GLO Contract No. 450, dated June 11 1882. Surveyor General record states: As the Corners on West boundary of this Township are not suitable for survey of T.1 S.
R.37 E. . . I am therefore, compelled to resurvey it. 12.74 chains, the Corner to Secs. 6, 7, 1 & 12, which is a fir 5 in diam marked T.1.S. S. 6 on NE
R 37 E S. 7 on SE, R 36 E S. 12 on SW and S. 1 on NW with 5 notches on S and 1 on N edges, from which:

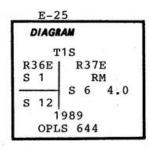

A pine 7 in diam bears S 80° E 7 lks dist marked T.1.S. R. 37 E. S. 7 B.T.
A pine 4 in diam bears N 45° E 5 lks dist marked T.1.S. R. 37 E. S. 6, B.T.
A pine 12 in diam bears S 66° W 15 lks dist marked T.1.S. R. 36 E. S. 12 B.T.
A pine 10 in diam bears N 19° W 21 lks dist marked T.1.S. R. 36 E. S. 1 B.T.
Corner found by Herman D. Gradon under GLO Contract No. 452, dated June
16, 1882. Surveyor General Records state: Cor to Sec's 1, 6, 7 & 12

which is a post 4 ins square marked T1S. S6 on N.E., R36E. S7 on S.E., R36E. S12 on S.W. and S1 on N.W. faces, with 5 notches on S. and 1 notch on N. edges. Corner resurveyed by Douglas M. Ferguson, OPLS 848 in 1972. His record states: Found 18 in. fir, original corner tree, with healed over blaze visible on 4 sides, from which: Found a rotten lodge pole pine, no scribing visible, bearing S80°E, 5 ft. from cor. tree. Found a 6 in. lodge pole pine, dead and down, with scribing visible, bearing approximately N45°E 3. ft. from corner tree. Found a 14 in. lodge pole pine, dead and down, with scribing visible, bearing approximately S66°W, 10 ft. from corner tree. Found a 14 in. lodge pole pine, live in good condition, bearing N19°W 14 ft. from Corner tree. No brass cap monument set, Orginal corner tree is in good condition. Took new bearing trees: A fir 14 in. diam. bears N80°E 12 ft. dist. marked T1S R37E S6 BT. A fir 20 in. diam. bears S32°W 22.5 ft. dist. marked T1S R36E S12 BT. Distance taken to a brass washer in the blaze of tree. Set a steel

fence post approximately 5 ft. South from corner postion with Forest Boundary sign attached. Corner perpetuated by Duane I. Griffith, OPLS 644 in 1989. His record states: Found 21" White Fir live and vigorous with blazes evident on four sides. (Corner Tree) FERGUSON BEARING TREES: Found a 16" White Fir N80°E 12.0 ft. live & vigorous with blaze evident. Found a 22" White Fir S32°W 22.5 ft. live & vigorous with blaze evident. ORIGINAL BEARING TREES: Found a 14" Lodgepole Pine S66°W 10.0 ft. dead and down with scribes visible. Found a 16" Lodge pole Pine N19°W 14.0 ft. live but sickly with scribes visible. Found a steel fencepost approximately 5 feet South of the corner tree with Property Boundary and Attention signs attached. Distance to the original BTs is to the estimated face of blaze. Distance to the Ferguson BTs is to the center of the tree. Set a $2\frac{1}{2} \times 30$ inch aluminum pipe with aluminum cap (marked as shown in corner diagram), North 4.00 feet from the center of the original corner tree. The monument is buried 28 inches in the ground. Painted a 6 inch red band around all BTs and attached bearing tree and land survey monument signs.

See Certified Land Record no. H-154-R for Ferguson record, and Map of Survey no. 89-101-B for Griffith record.

PROFESSIONAL LAND SURVEYOR

Sheet 2 of 2

OREGON
JULY 22, 19/7
WILLIAM R. WELLS
1106

RECEIVED BY

Form R6-7100-57 (9/71)

Umatilla County Surveyor . GPO-

*GPO-591-971, 1988

Date 12-94
Rec'd Dy XX
No. 94-120-B