
History of original corner establishment:

Corner originally established by Henry Meldrum under GLO contract number 450, dated June 11, 1882. Surveyor General record states:

Set basalt stone 16x8x7 ins 11 ins in ground for $\frac{1}{4}$ sec cormarked $\frac{1}{4}$ on N face from which;

A fir 16 in diam bears S4°W 66 lks dist marked ¼S BT A pine 30 in diam bears N23°W 109 lks dist marked ¼S BT

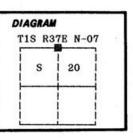

No record of subsequent monumentation found in Umatilla County survey records.

Description of corner evidence found:

Found a possible small mound of stone at the corner position as determined from the record bearing and distance from the Southerly bearing tree. Found no evidence of the original corner stone.

Found a 26 inch diameter Douglas Fir S4°W, 66 lks, live but sickly with blaze evident.

Found a 26 inch diameter Ponderosa Pine N2°W, 68 feet, dead and down with BT scribe visible. (Record N23°W, 109 lks. Stump hole is 109 lks when measured on the slope.)

Description of monument and accessories I established to perpetuate the

original location of this corner: At record bearing and distance from the Southerly found original bearing tree, I set a 2½" x 30" aluminum pipe with aluminum cap marked as shown, 22" inches in the ground, from which:

New BTs: A 11 inch diameter Ponderosa Pine bears S37°W, 27.37 feet marked ¼ S20 BT A 13 inch diameter Douglas Fir bears N10°W, 97.2 feet marked ¼ S17 BT

Painted a 6 inch red band around all BTs and attached bearing tree and land survey monument signs.

Set a steel fencepost approximately 5 feet East with land survey monument sign attached.

Raised a mound of stone around monument, 4 ft. base to top of cap.

I hereby certify that the above corner point was perpetuated as hereon described on August 27, 1989.

GRIFFITH T1S R37E S 17 S 20 1989 OPLS 644

REGISTERED PROFESSIONAL ND SURVEYOR OREGON DUANE I. GRIFFITH

I used a steel tape and magnetic compass in the establishment of new accessories. I used 20° East magnetic declination and the distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

Office of the Survive Depts County of Umatila.

State of OR I hereby certify that the within instrument was filed in this office for record on the 27 day of Odoben 1989 David H. Krambein by Kathleen & Amsberry (COUNTY OFFICIAL)

Form R6-7100-57 (9/71)

RECESVED BY Untille County Entry you

*GPO-591-971, 1988

coding KA

N-07