## OREGON CORNER RESTORATION FORM

SECTION: 18 TOWNSHIP: 2N RANGE: 29E J-1

COUNTY: UMATILLA DATE: 8/2010

CORNER DESIGNATION

NW 18

CONDITION REPORT ONLY

NOT FOUND

RENEWED

UNRECORDED

X SURVEYED IN

X REFERENCED OUT


# PREVIOUS RENEWALS/SURVEYS ETC.

Originally surveyed by Thompson under Contract #83 in 1859. He set post and made mound. In 1980 Terry Hamby set a 2 ½" brass cap.

# MONUMENTS AND ACCESSORIES FOUND: CONDITON AND SOURCE Nothing found.

MONUMENT DETAIL

T2N R28E R29E 1217 13|18 2007 LS 951

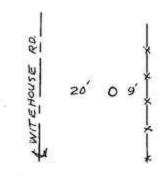

#### OREGON STATE PLANE COORDINATES NORTH ZONE, NAD 83(91), Int Feet:

729260.66 8522072.05

## MONUMENT SET (PROCEDURES AND DESCRIPTION)

By retracing Hanbys 1980 survey I set a 2 3/8" brass cap stamped as above, on a 1" by 30" iron pipe 6" above the ground at the location of his brass cap which had been obliterated. Placed a collar of stone around and drove T post. See my County Survey of T2N, R29E, dated 2010.

## NEW ACCESSORIES FROM WHICH

A 5/8" x 30" Iron Rebar with plastic cap #951 bears N 0° 24' 14" W 38.56' A 5/8" x 30" Iron Rebar with plastic cap #951 bears N 81° 34' 20" E 9.02' A 5/8" x 30" Iron Rebar with plastic cap # 951 bears S 10° 03' 21" E 44.68' A 5/8" x 30" Iron Rebar with plastic cap # 951 bears N 88° 11' 48" W 46.62' These bearings and distances are State Plane.

## LOCATION AND COMMENTS

From the intersection of Vey Road with Whitehouse Road go south along Whitehouse Road 2 miles to corner. Corner lies 20' East of centerline graveled road. The bearings and distances shown are grid.

FIRM: EDWARDS SURVEYING LLC PO BOX 763 - HERMISTON OR 97838

PARTY CHIEF: G. EDWARDS WITNESS: R. SMITH

C:\Works\N5R29-J1

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON JULY 16, 1971 G. DENNIS EDWARDS 9.5.1

RENEWS 12/31/11

11-65-C