

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T 2N, R 32E., W.M.


Corner Code No. E-11

Note: Monument marked as shown below

History of original corner establishment:

This corner was originally established by D. Chaplin, U.S Deputy Surveyor, under Contract No. 107, dated August 21, 1864. The original notes state that at the corner a wood post, with charred stake, earth mound and pits was established for the corner.

In 1954, this corner was reestablished by City of Pendleton crews, by single proportion measure, 1/2 way between the reestablished S.E. and S.W. corners of Section 4. The City record indicates that a 60 penny spike was set in concrete, 30" below ground, for the corner monument.

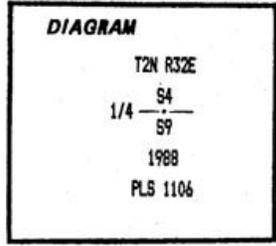

Corner No.
Compass Declination: 18.0

Description of corner evidence found:

Found 60 penny spike, set in concrete, 24" below ground surface.

Description of monument and accessories I established to perpetuate the original location of this corner:

Left the 60 penny spike in place. Directly above the spike, I set a 2 1/2" brass cap on a 1 1/2" by 30" galv. iron pipe and surrounded it with a mound of earth and stone.

Referenced the monument as follows. From the new corner monument:

The top hinge bolt on the west face of a 12" by 12" by 4 1/2' high concrete pedestal bears S88° E 27.85'.

A 1 1/2" aluminum cap, marked as shown, set on a 5/8" by 30" iron rod, bears S10° W 17.60'. Set steel fence post near the reference monument and attached witness corner and bearing object signs.

Set steel fence post east of the corner monument and attached witness corner sign.

The aluminum cap on the reference monument is marked as follows:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106



Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19....

..... by
(COUNTY OFFICIAL) (DEPUTY)