

**OREGON CORNER RESTORATION FORM**

Section 8,17  
County Umatilla

Township 3N  
Date: 03/11/10

Range 29E

Corner Designation: 3N29J7

Corner common to Sections 8,17 T3NR29E.

- Condition Report Only
- Not Found
- Remonumented
- Unrecorded
- Surveyed In
- Referenced Out


**Previous Renewals / Surveys, etc.**

Gates set a charred stake in a mound of earth, 1859.  
Position calculated and shown on Harris Survey No. 98-11-B. Nothing set.


**Monuments and Accessories Found: (Condition and Source)**

None.

Diagram

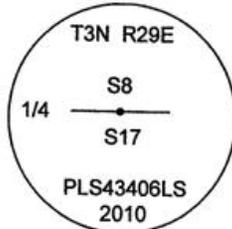

Sketch

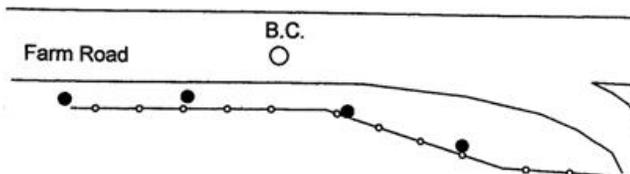

NAD 83/91  
OREGON STATE PLANE NORTH  
INTERNATIONAL FEET

N761357.11  
E8530067.91

LAT - 45° 44' 52.17224451" N  
LON - 119° 12' 54.78991284" W

**Monument (s) Set (Procedures and Description)**

A 1" id x30" Galvanized Iron pipe with a 2 1/2" Brass cap, buried 8" below road surface, stamped as shown above. The road bed appears to be built up about 1.5' above the existing ground.

**References Set:**

- A 5/8"x30" Iron rebar w/rpc #43406, at a steel fence post lies S 82° W, 43.81'.
- A 5/8"x30" Iron rebar w/rpc #43406, at a steel fence post lies S 67°30' W, 17.06'.
- A 5/8"x30" Iron rebar w/rpc #43406, at a steel fence post lies S 60° E, 23.04'.
- A 5/8"x30" Iron rebar w/rpc #43406, at a steel fence post lies S 63° E, 37.50'.

**Location and Comments**

The corner is 0.75 miles North from the intersection of Hwy. 320 and Snow Road, then Right on a rocked farm road 0.25 miles.

**Compass Declination**

17° E

**Surveyors Seal**

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

**RECEIVED BY:**

Date: 8-10  
Rec'd By: KK  
No. 10.26-R

**Firm / Agency**

Survey One, LLC.  
P.O. Box 382  
Pendleton, OR 97801  
(541) 276-2055

*Robert D. English*  
OREGON  
JANUARY 11, 2005  
ROBERT DOUGLAS ENGLISH  
43406LS

RENEWAL DATE: 12/31/11