

OREGON CORNER RESTORATION FORM

Section 13 Township 3N Range 32E
 County Umatilla Date: October 10, 2006

Corner Designation: 3N32N23

Quarter corner to sections 13 and 24, T3N, R32E,
 W.M., Umatilla County, Oregon.


Condition Report Only
 Not found
 Remonumented
 Unrecorded
 Surveyed in
 Referenced out

Previous Renewals / Surveys, etc.


Corner originally set by Daniel Chaplin under contract No. 107 dated September 21, 1864. His record reads: Set post for 1/4 Sec. cor. in mound of earth with charred stake, pits & c as per instructions.

Monument and Accessories found: (condition and source)

None. The position falls in the center of the County Road. There are long term fences running north and south along the section lines.

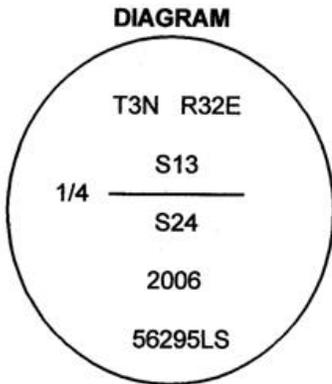

⊕ = Brass Cap
 • = Rebar Reference

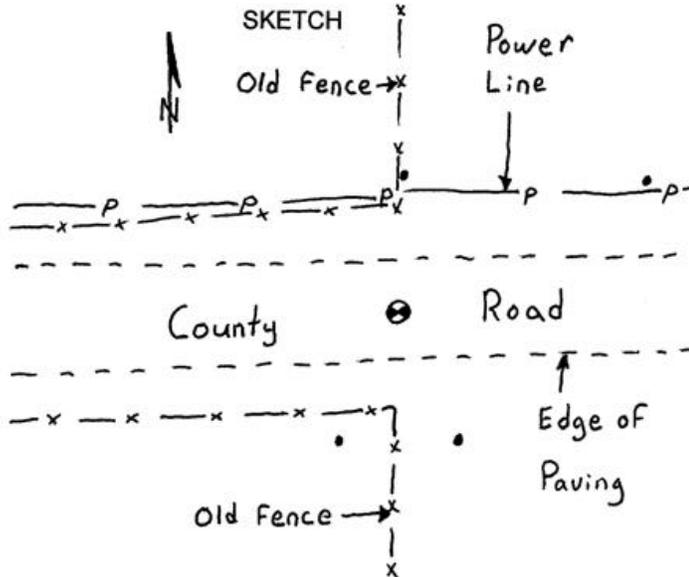

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)

I set a 1 1/4" x 30" galvanized iron pipe with a 2 3/8" brass cap stamped as shown in the diagram above at the intersection of the County Road centerline and the north and south fence lines. I poured concrete around the top 10" of the monument flush with the asphalt.

For references, I set four 5/8" by 18" rebars with 1 1/8" orange plastic caps stamped WTS and 56295LS as described below:

- an iron rebar bears N00°54'11"E, 29.89 feet;
- an iron rebar bears N75°37'37"E, 126.78 feet 18" below the surface;
- an iron rebar bears S27°33'13"W, 32.90 feet 18" below the surface;
- an iron rebar bears 271°37'52"E, 34.68 feet 18" below the surface;

The monument and references were tied using a Trimble R7/R8 RTK GPS.

Location and comments

Compass Declination

Firm / Agency
 Witness Tree Surveying
 Address
 P.O. Box G
 Pilot Rock, Or. 97868
 Party Chief
 Stephen K, Haddock

RECEIVED BY:
Umatilla County Surveyor
 Date: 12-06
 Rec'd By: _____
 No. 06-606-C

Surveyors Seal

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

Stephen K. Haddock

OREGON
 JULY 9, 2001
 STEPHEN K. HADDOCK
 56295LS

RENEWAL DATE 6-30-07