OREGON CORNER RESTORATION FORM

SECTION 25 TOWNSHIP 4 NORTH RANGE 27 EAST

T-23

COUNTY: UMATILLA

DATE 12/02

CORNER DESIGNATION

X CONDITION REPORT ONLY

__NOT_FOUND __RENEWED

CTR. 1/4 CORNER

__ UNCOVERED __ SURVEYED IN __ X REFERENCED

PREVIOUS RENEWALS / SURVEYS, ETC.

ORIGINALLY SURVEYED UNDER CONTRACT #209 IN 1874 BY WALDEN. STAEBLER 1981, CS #S-141.

MONUMENTS AND ACCESSORIES FOUND: CONDITION AND SOURCE

A 1/2" IRON ROD. A 1/2" IRON ROD WITH A YELLOW PLASTIC CAP MKD "#951" LIES S 0'13'51" W, 60.06 FEET. A 1/2" IRON ROD LIES N 0'13'33" E, 299.70 FEET.


MONUMENT DETAIL

1/2" IRON ROD.
N.T.S

NAD 83/91 OREGON STATE PLANE INTERNATIONAL FEET

> 779484.0041 8487012.6496

SKETCH

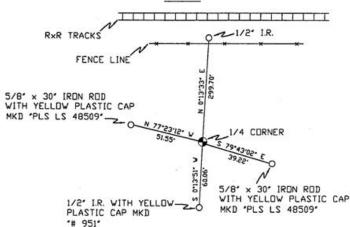

MONUMENT SET

(PROCEDURES AND DESCRIPTION)

NEW ACCESSORIES FROM WHICH

A 5/8" x 30" IRON ROD WITH A YELLOW PLASTIC CAP MKD "PLS LS 48509" LIES N 77'23'12" W, 51.55 FEET. A 5/8" x 30" IRON ROD WITH A YELLOW PLASTIC CAP MKD "PLS LS 48509" LIES S 79'43'02" E, 39.22 FEET.

LOCATION AND COMMENTS

FROM INTERSECTION OF RxR TRACKS AND WESTLAND RD. GO WEST 0.5 MILES AND THEN SOUTH $\pm 10^{-1}$ 300 FEET TO CORNER.

COMPASS DEC.

FIRM/AGENCY
PRIMM LAND SURVEYING
P.O. BOX 1322
HERMISTON, OREGON 97838

PARTY CHIEF KEITH P. PRIMM

NOTES

WITNESS BRIT L. PRIMM SURVEYOR'S SEAL

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON JULY 13, 1999 BRIT L. PRIMM 48509

EXPIRATION DATE: 12/31/04

03-49-9