OREGON CORNER RESTORATION FORM

SECTION 17,18,19,20 TOWNSHIP 4 NORTH RANGE 29 EAST

COUNTY UMATILLA MAY/20

CORNER DESIGNATION

REPORT ONLY

N-5

X CONDITION RE
NOT FOUND
X RENEWED
UNCOVERED
SURVEYED IN
REFERENCED

SECTION CORNER

PREVIOUS RENEWALS / SURVEYS, ETC.

ORIGINALLY SURVEYED IN 1861 BY DAVENPORT UNDER CONTRACT #101. HE IN A MOUND OF EARTH AND A CHARRED STAKE.


IN 1998 EDWARDS SET A 2 3/8" BC STAMPED AS BELOW. SET ➣

MONUMENTS AND ACCESSORIES FOUND: CONDITION AND SOURCE

A 5/8" IRON ROD I A 2 3/8" BC STAMPED AN ALUMINUM TAG AN ALUMINUM TAG A TAG #951 ON A POWER POLE STUB LIES S 62*45'14" W, 1 TAG #951 ON A RXR TIE LIES S 20*07'19" E, 61.61 FEET. ROD WITH AN ALUMINUM TAG LIES S 89*41'41" W, 30.00 FE ROD WITH AN ALUMINUM TAG LIES N 89*41'36" E, 18.50 FE AS BELOW. 18.50 FEET. FEET. 23.89

MONUMENT DETAIL

SKETCH

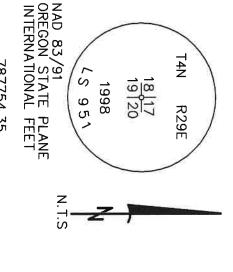

5/8' IRON ROD
WITH ALUMINUM TAG
MKD "#951" AL TAG #951 STUB POLE SECTION CORNER CANAL RD. 189*41'36" E 5/8" IRON ROD WITH ALUMINUM TAG MKD "#951"

787754.35 8526975.15

AL TAG #951 RXR TIE

MONUMENT SET PROCEDURES AND DESCRIPTION

WEW ACCESSORIES FROM WHICH

LOCATION AND COMMENTS

FROM INTERSECTION OF FEEDVILLE RD. AND CANAL RD. GO NORTH ON CANAL RD. 1 MILE TO CORNER.

COMPASS DEC.

PRIMM LAND SURVEYING P.O. BOX 1322 HERMISTON, OREGON 97838 FIRM/AGENCY

PARTY CHIEF

NOTES

KEITH P. WITNESS PRIMM

> SURVEYOR'S SEAL

LAND SURVEYOR REGISTERED PROFESSIONAL

OREGON
JULY 12, 2005
KEITH P. PRIMM
48490

EXPIRATION DATE: 12/31/20

DEC