OREGON CORNER RESTORATION FORM

SECTION 16 TOWNSHIP 5N RANGE 29E

N-11

COUNTY: UMATILLA

DATE 7/91 Revised 10/91

CORNER DESIGNATION

South 1/4 Corner

__CONDITION REPORT ONLY

__NOT FOUND RENEWED

__UNRECORDED

x_SURVEYED IN


x_REFERENCED OUT

PREVIOUS RENEWALS/SURVEYS, ETC.

Originally surveyed in 1861 by Davenport under Contract #101. He set post, made mound and drove charred stake.

MONUMENTS & ACCESSORIES FOUND: Condition and Source

Nothing found. On 10/17/91 while setting additional references, we found a 2" Iron pipe similar to those set by Kimbrell around 1910 lying S 88°29' W 34.41 feet from my proportioned corner. I held my location because there is no record of said 2" Iron pipe and my location fits other monuments much better than said 2" Iron pipe. See my Survey, Co. #91-058-B.
MONUMENT DETAIL

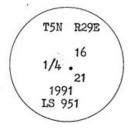

MONUMENT SET (PROCEDURES AND DESCRIPTION)

By single proportion I set 1" x 30" Iron pipe with 2 3/8" Brass Cap, stamped as above, 7" above surface and placed an 18" diameter ring of stone around. See Co. Survey #91-058-B.

NEW ACCESSORIES From which

A steel fence post with witness sign Bears. North 3.7 ft.

A 1/2" x 24" rebar with Alum. tag #951 Bears. N89° 15' 07"E 8.30 ft.

A steel fence post Bears. S0° 08' 44"E 139.2 feet,

A 1 1/2" washer stamped W.C. 43.75 Bears. N25° 44' 30"W 43.75 feet,
glued to 2' high rock face. Also stamped 951.

A 1 1/2" washer stamped W.C. 19.70 and LS 951 glued to a 1 foot high rock
face Bears. S 5°32' W 19.70 feet.

A found 2" Iron pipe (No record) Bears. S 88°29' W 34.41 feet.

LOCATION & COMMENTS

From intersection of Hwy. #207 & #730, go easterly 0.9 Miles to a fence corner on South R/W line. Corner lies 2,200 feet North.

SURVEYOR'S SEAL

COMPASS DEC.
FIRM EDWARDS SURVEYING
P.O.BOX 763, HERMISTON,
OREGON, 97838
PARTY CHIEF D. EDWARDS
NOTES

WITNESS S. BENEFIT

RECEIVED BY

umanina .	County Surveyor
Date/	
Rec'd By	KK
No. 9/	-89-8

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGÓN
JULY 18, 1971
G. DENNIS EDWARDS
951