
History	of	originol	corner	establishment

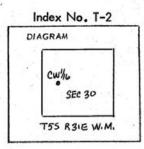

No record of subsequent remonumentation found in County Records .

None

None

Description of monument and accessories I established to perpetuate the original location of this corner

At the corner position a 2 inch by 30 inch iron pipe, with brass cap marked as shown, was set 15 inches in the ground and surrounded with a mound of stones to the cap.

Set steel fence post on line North of corner and attached signs 54-2 and 54-9. Set 2 New BT's:

6"Red Fir Bears S84°E 40.5 ft scribed CW 1/16 530 BT

8" Red Fir Bears S 19°W 12.7 ft. scribed CW 1/16 530 BT.

BT's have lower blaze scribed BT with a brass washer stamped PLS 1106 nailed to it.

BT's have 54-3 and 54-4 signs attached and a 6" red band painted around them above blaze.

Used steel tape and magnetic compass with $19\frac{1}{2}^{\circ}$ east declination. Measured to center of Bts. See map of survey REGISTERED T55 R31E PROFESSIONAL This corner set August 27, 1979 LAND SURVEYOR Willia R. Wells Greg Flowers L.S.I.T. Witnesses: 930 **Brent Reynolds** OREGON 1979 JULY 22, 1977 PLS 1106 WILLIAM R. WELLS 1106 Office of County Surveyor Umatilla State of Oregon , I hereby certify that the within instrument was filed in this office RECEIVED BY Imatilla County Surveyor

Form R6-7100-57 (9/71)

.: GPO 795 AN

sec'd By M. A

Note: This corner was established in error in 7/79 and bearing trees established. When the corner was established in its true position, scribing and signs were removed from the BT's referencing the erroneous position From the correct corner position: A 8½" red fir bears N 16½°E 50.5 ft with open blaze A 8" bullpine bears S35½°E 42.3 ft with open blaze