CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment: Corner established under G.L.O. Contract No. 410, in 1881 by George S. Pershin. Surveyor General's records state.

Set basalt stone 14x12x8 ins. on level in creek bottom 10 ins. in ground for 1/4 Sec. Cor. marked 1/4 on West face. From which:

A Pine 6 ins. dia. brs. N38°E, 9 lks. dist. marked

A Pine 10 ins. dia. brs. N38°W, 12 lks. dist. marked 1/4 S. B.T.

Index File No. C-25 DIAGRAM

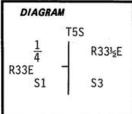

Description of corner evidence found: A diligent search was made and no evidence of original stone or its accessories could be found.

Description of monument and accessories I established to perpetuate the

original location of this corner: At point established by single proportion measurement between N.E. Corner and S.E. Corner of S1, T5S, R33E. Set 2½"x30" galvanized pipe with brass cap stamped:

Set pipe 24" in ground with mound of stone to cap.

R33E
$$\frac{1}{4}$$
 R331 E S3 1980 OR PLS 1294

From which:

A P. Pine 17" dia. bears S70°W, 25.2 ft., scribed 1/4 S1 BT. A Lodge Pole Pine 5" dia. bears N42°W, 69.2 ft., scribed 1/4 S1 BT. Attached 54-3 and 54-4 signs to both BTs. Attached brass washer stamped L.S. 1294 to foot blaze of both BTs. Painted blazes and 6" band around both BTs red. Attached 54-2 and 54-4 signs to metal post 5 ft. south of corner. Attached 54-2 sign to metal post 5 ft. west of corner.



I hereby certify the above corner monument was reestablished as herein described on June 13, 1980.

Witnesses: R. Orton

G. Orton

D. Allen

County Surveyor County of Umatilla State of Oregon , I heppby certify that the within instrument was filed in this office (COUNTY OFFICIAL)

Form R6-7100-57 (9/71)

☆ GPO---798-276

R-187-B