
OREGON CORNER RESTORATION FORM

33E Section 23 Township 6N Range County Umatilla April 1, 2003 Date: Condition Report Only Corner Designation: 6N33R19 Not found Remonumented Unrecorded Common guarter corner to sections 23 and 26, T6N, R33E, W.M., Umatilla County, Oregon. Surveyed in Referenced out State Plane Coordinates, Oregon North, 83(1991) based on a single GPS tie to Tri Station Geer, N = 847729.88 E = 8671697.18

Previous Renewals / Surveys, etc.

Corner originally set by Nicholas O. Walden under contract #209 dated July 6, 1874. His record reads: Set basalt stone, 12 x 10 x 9, 6 ins. in ground for 1/4 Sec. Cor.

Monument and Accessories found: (condition and source)
Waldens Stone, plainly marked 1/4, firmly in place.

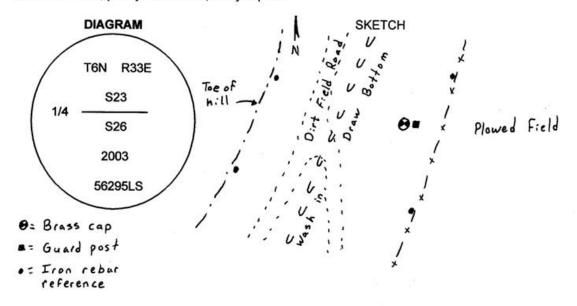

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)
I set a 2 1/4" brass cap on a 1 1/2" x 30" galvanized iron pipe 30" in the ground. I buried the original stone at the foot of the monument. I set a 5' Steel guard post with a County mounument sign attached along side.

For references, I set four 5/8" by 24" green coated iron rebars with 1 1/8" orange plastic caps stamped WTS and 56295LS as described below:

- a rebar bears N59°41'00"E, 30.91 feet;
- a rebar bears N40°47'33"W, 116.97 feet;
- a rebar bears N88°07'21"W, 125.99 feet;
- a rebar bears S08°21'02"W, 46.21 feet;

The monument and references were tied using a LIECA system 300 RTK GPS.

Location and comments Compass Declination Surveyors Seal Firm / Agency REGISTERED Witness Tree Surveying **PROFESSIONAL** RECEIVED BY: Address LAND SURVEYOR Umatilla County Surveyor P.O. Box G Date: Pilot Rock, Or. 97868 Rec'd By Party Chief Stephen K, Haddock STEPHEN K. HADDOCK

RENEWAL DATE 6-30-05