OREGON CORNER RESTORATION FORM


| Section | 25 | Township | 6NR | ange | 33E | |
|---|-----------------|--------------|----------------|------|-----|-----------------------|
| County | Umatilla | Date: | December 11 | 2002 | | |
| | | | | | | Condition Report Only |
| Corner Designation: 6N33R23 | | | | | | Not found |
| Outlier De | oignation. | 011001120 | | | X | Remonumented |
| Common quarter corner to sections 24 and 25, T6N, R33E, | | | | | | Unrecorded |
| W.M., Umatilla County, Oregon. | | | | | | Surveyed in |
| , , , , , , , , , , , , , , , , , , , | iatilia ocarity | , c.ogo | | | X | Referenced out |
| State Plan | ne Coordinat | es. Oregon N | orth, 83(1991) | | | |

Previous Renewals / Surveys, etc.

N = 847061.90 E = 8676998.21

Corner originally set by Nicholas O. Walden under contract #209 dated July 6, 1874. His record reads: Set basalt stone, 14 x 12 x 5, 7 inches in the ground for the 1/4 section corner.

Monument and Accessories found: (condition and source) Waldens Stone, plainly marked 1/4, firmly in place approximately 74 feet southerly of a fence corner with fences running north and east.

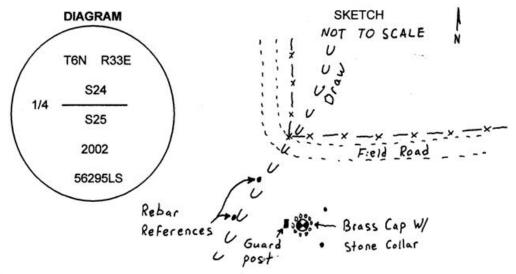

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)
I set a 2 1/4" brass cap on a 1 1/2" x 30" galvanized iron pipe 28" in the ground. I placed an 18" collar of stones around the monument and buried the original stone at the foot of the monument on the East side. I set a 5 foot steel guard post with a County monument sign attached along side.

For references, I set four 5/8" by 24" green coated iron rebars with 1 1/8" orange plastic caps stamped WTS and 56295LS as described below: an iron rebar bears N54°49'05"E, 25.21 feet 6 inches below the surface; an iron rebar bears S51°21'45"E, 25.33 feet 6 inches below the surface; an iron rebar bears N49°43'13"W, 62.29 feet on the west side of the draw; an iron rebar bears N80°21'56"W, 68.67 feet on top of a small rock outcrop on the west side of the draw.

The monument and references were tied using a LIECA system 300 RTK GPS.

Location and comments
The original stone was
witnessed by PLS 852,
David L. Haddock
RECEIVED BY:
Umatilla County Surveyor
Date:
Rec'd By:
No. 03-21-C

Compass Declination

Firm / Agency Witness Tree Surveying Address P.O. Box G Pilot Rock, Or. 97868 Party Chief Stephen K, Haddock Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 9, 2001
STEPHEN K. HADDOCK
56295LS.

RENEWAL DATE 6-30-03