

OREGON CORNER RESTORATION FORM

Section: 25,26,35,36
Township: 6 North
Range: 35 East of the Willamette Meridian
County: Umatilla
Date: June 28, 2002

Corner Indexing Information: Township 6N Range 35E Corner Code V 21 (Willamette Meridian)
Additional Identifier: (e.g. BLM designation for the corner, street intersection, plat name, block, lot, etc.)

This corner is common to sections: 25,26,35,36

Oregon Plane Coordinates: N: 843825.687 E: 8738044.284

Zone: North **Order:** second **Datum:** NAD83-91 **Convergence:** **Scale Factor:**


Previous Renewals/Surveys, etc.: Originally surveyed by U.S. Deputy Surveyor William Odell under his contract No. 110 dated 8-23-1865. The Surveyor General's notes state "set post corner to Sections 25, 26, 35 & 36. Drove charred stake, dug pits and raised mound as per instructions". In 1893, survey No. 61, Book 1, Page 276, Arnold found the original charred stake and set an oval shaped porous river boulder 18" long and 10" in diameter. In 1957, survey No. Q-833-A, Newbill found a rock. In 1977, survey No. N-45-A, Krumbain set a railroad spike from witness corners. In 1986, survey No. 86-31-B, Krumbain found a stone with witness corners North and South. In 1990, survey No. 90-64-B, Tomkins set a railroad spike from witness corners NE and SE. In 1991, survey No. 91-16-B, Munns found a rock and set a brass cap. Circa 1995, the Oregon Department of Transportation resurfaced the road and set a brass cap in a monument case. No history of the witness corners could be found.

Monument(s) & Accessories Found (Condition & Source):

At the southwest corner of section 25, T6N R35E, we found a 3" brass cap in 5" diameter iron monument case 2 1/2" below the surface pavement. From which a 2 1/2" brass cap stamped as shown bears N42°E ~ 43.43 feet.

Monument Set (Procedures & Description):

Monument Detail:

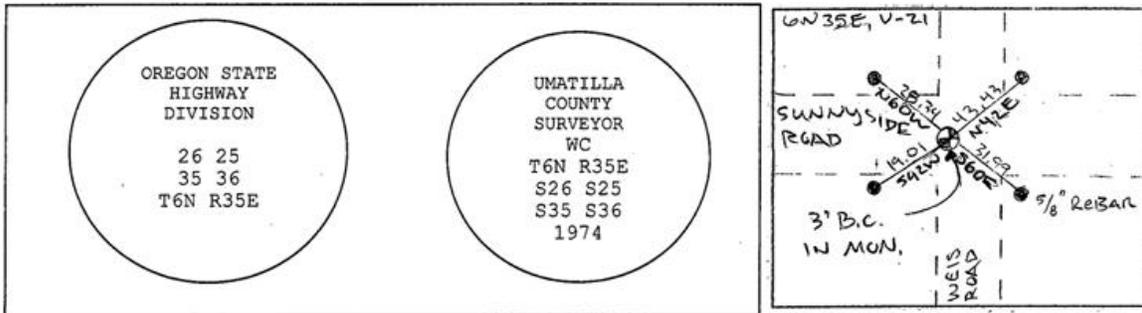

New Accessories: WE SET:

Attached a Umatilla County Bearing object sign to south face of telephone junction box at the bottom NE or the witness corner. A 5/8 rebar with yellow plastic cap stamped 'Tomkins Surveying' which bears S 60°E ~ 31.99 feet from the corner. Attached a Umatilla County Bearing object sign to the northwest face of power pole. A 5/8 rebar with yellow plastic cap stamped 'Tomkins Surveying' which bears S 42°W ~ 19.01 feet from the corner. No Umatilla County Bearing object sign or t-post set. A 5/8 rebar with yellow plastic cap stamped 'Tomkins Surveying' which bears N 60°W ~ 28.34 feet from the corner. No Umatilla County Bearing object sign or t-post set.

Location & Comments:

Compass Declination:



19° East

Firm/Agency: Tomkins Land Surveying, Inc.
 20 E. Poplar, Suite 204
 Walla Walla, WA 99362

Party Chief: Bryan Martin
Notes: Bryan Martin
Witness: Eric Flowers

or1cr6N35EV21.doc

Surveyor's Seal

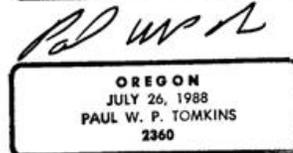

renews 6/30/04
6/30/02

03-23-e