

OREGON CORNER RESTORATION FORM

Section 34 Township 6N Range 36E
 County Umatilla Date: November 26, 2007

Corner Designation: 6N36V15

Quarter corner common to sections 27 and 34, T6N, R36E,
 W.M., Umatilla County, Oregon.

Condition Report Only
 Not found
 Remonumented
 Unrecorded
 Surveyed in
 Referenced out


Previous Renewals / Surveys, etc.

Corner originally set by Odell and Lewis under contract No. 110 dated February 7, 1865. Their record reads: Dug pits & raised mound as per instructions; This corner was found in the survey in the Record of Private Surveys Book 1, Page 401 but no monument was identified.

Monument and Accessories found: (condition and source)

None: The point falls on a long term north south plow berm between farm fields.

DIAGRAM

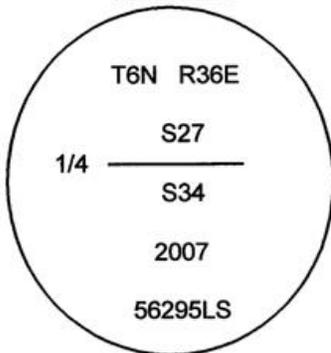

SKETCH

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)

At the position established from evidence from Book 1, Page 401 and the long time plow berm, I set a 1 1/2" x 30" galvanized iron pipe with a 2 1/4" brass cap attached stamped as shown in the diagram above.

For references, I set four 5/8" by 24" rebars with 1.25" orange plastic caps stamped WTS and 56295LS as described below:

- an iron rebar bears N41°35'45"E, 28.55 feet;
- an iron rebar bears N46°15'50"W, 32.00 feet;
- an iron rebar bears S37°52'04"W, 29.73 feet;
- an iron rebar bears S42°10'11"E, 29.21 feet;

The monument and references are 2 feet below the surface of the plowed berm.

The monument was set and references were tied using a Trimble R7/R8 RTK GPS.



Location and comments

Compass Declination

Surveyors Seal

RECEIVED BY:
Umatilla County Surveyor
 Date: 02-08
 Rec'd By: [Signature]
 No. 08-039-C

Firm / Agency
 Witness Tree Surveying
 Address
 P.O. Box G
 Pilot Rock, Or. 97868
 Party Chief
 Stephen K, Haddock

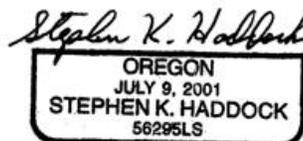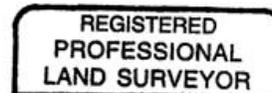

RENEWAL DATE 6-30-09